

EVERLAST

POWER TIG 350 EXT

Digitally Controlled AC/DC Pulse TIG/Stick Welder



Operator's Manual for the PowerTIG 350 EXT Safety, Setup and General Use Guide

everlastwelders.com

Rev.3 0 030103-17



1-877-755-9353
329 Littlefield Ave. South San Francisco, CA 94080 USA

Specifications and Accessories subject to change without notice.

Table of Contents

Section.....	Page
Letter to the Customer	3
Everlast Contact Information.....	4
Safety Precautions.....	5
Introduction and Specifications.....	9
Unit Specifications.....	10
General Overview.....	11
General Use and Care.....	11
Quick Setup Guide, TIG Torch/Cooler Connection	12
Quick Setup Guide, Stick Polarity.....	13
Rear Panel Gas Connection and Wiring.....	14
Front Panel Features and Controls.....	15
Rear Panel Features and Controls.....	21
Welder Function Summary and Explanations.....	23
Tungsten Preparation.....	29
Lift Start and High Frequency Start.....	30
Stick Starting Methods.....	31
Recommendations for Polarity/Amps/Tungsten..	32
Expanded View of TIG torch.....	33
7 Pin Connector Pinout.....	34
Troubleshooting.....	35
Trouble Codes.....	36

NOTE: Product Specifications and features are subject to change without notice. While every attempt has been made to provide the most accurate and current information possible at the time of publication, this manual is intended to be a general guide and not intended to be exhaustive in its content regarding safety, welding, or the operation/maintenance of this unit. Everlast Power Equipment INC. does not guarantee the accuracy, completeness, authority or authenticity of the information contained within this manual. The owner of this product assumes all liability for its use and maintenance. Everlast Power Equipment INC. does not warrant this product or this document for fitness for any particular purpose, for performance/accuracy or for suitability of application. Furthermore, Everlast Power Equipment LLC does not accept liability for injury or damages, consequential or incidental, resulting from the use of this product or resulting from the content found in this document or accept claims by a third party of such liability.

Dear Customer,

THANKS! You had a choice, and you bought an Everlast. We appreciate you as a customer and hope that you will enjoy years of use from your welder.

Please go directly to the Everlast website to register your unit and to download your current warranty information. Your unit registration is important should any information such as product updates or recalls be issued. It is also important so that we may track your satisfaction with Everlast products and services. If you are unable to register by website, contact Everlast directly through the sales department through the main customer service number in your country. Your unit will be registered and warranty will be issued and in full effect. Keep all information regarding your purchase. **In the event of a problem you must contact technical support before your welder can be a candidate for warranty service and returned.**

Please review the current online warranty statement and information found on the website of the Everlast division located in or nearest to your country. Print it for your records and become familiar of its terms and conditions.

Everlast offers full technical support, in several different forms. We have online support available through email, and a welding support forum designed for customers and noncustomer interaction. Technical advisors are active on the forum daily. We also divide our support into two divisions: technical and welding performance. Should you have an issue or question concerning your unit, please contact performance/technical support available through the main company headquarters available in your country. For best service call the appropriate support line and follow up with an email, particularly if off hours, or you cannot reach a live person. In the event you do not reach a live person, particularly during heavy call volume times, holidays, and off hours, leave a message and your call will normally be returned within 24 hours. Also for quick answers to your basic questions, join the company owned forum available through the website. You'll find knowledgeable, helpful people and staff available to answer your questions, and perhaps find a topic that already addresses your question at <http://www.everlastgenerators.com/forums/>.

Should you need to call or write, always know your model name, purchase date and welder manufacturing inspection date. This will assure the quick and accurate customer service. **REMEMBER: Be as specific and informed as possible. Technical and performance advisors rely upon you to carefully describe the conditions and circumstances of your problem or question. Take notes of any issues as best you can. You may be asked many questions by the advisors to clarify problems or issues that may seem very basic. However, diagnosis procedures MUST be followed to begin the warranty process. Advisors can't assume anything, even with experienced users, and must cover all aspects to properly diagnose the problem. Depending upon your issue, it is advisable to have basic tools handy such as screwdrivers, wrenches, pliers, and even an inexpensive test meter with volt/ohm functions before you call.**

Let us know how we may be of service to you should you have any questions.

Sincerely,

Everlast Customer Service



Serial number: _____

Model number: _____

Date of Purchase _____

Everlast US:

Everlast consumer satisfaction email: sales@everlastwelders.com

Everlast Website: everlastwelders.com

Everlast Technical Support: support@everlastwelders.com

Everlast Support Forum: <http://www.everlastgenerators.com/forums/index.php>

Main toll free number: 1-877-755 WELD (9353) 9am—5pm PST M-F
11am-4pm PST Sat.

FAX: 1-650-588-8817

Everlast Canada:

Everlast consumer satisfaction email: sales@everlastwelders.ca

Everlast Website: everlastwelders.ca

Everlast Technical Support: sales@everlastwelders.ca

Telephone: 905-637-1637 9am-4:30pm EST M-F
10am-1pm EST Sat.

FAX: 1-905-639-2817

Everlast Australia:

Sydney: 5A Karloo Parade Newport NSW 2106

(02) 9999 2949

Port Macquarie: 2B Pandorea Place Port Macquarie

(02) 8209 3389

After hours support: 0413 447 492

Everlast Technical Support: support@pickproducts.com

Safety Precautions

Everlast is dedicated to providing you with the best possible equipment and service to meet the demanding jobs that you have. We want to go beyond delivering a satisfactory product to you. That is the reason we offer technical support to assist you with your needs should an occasion occur. With proper use and care your product should deliver years of trouble free service.



Safe operation and proper maintenance is your responsibility.

We have compiled this operator's manual, to instruct you in basic safety, operation and maintenance of your Everlast product to give you the best possible service and welding experience. Much of welding and cutting is based upon experience and common sense. As thorough as this welding manual may be, it is no substitute for either. Exercise extreme caution and care in all activities related to welding or cutting. Your safety, health and even life depends upon it. While accidents are never planned, preventing an accident requires careful planning and attention to detail.

Please carefully read this manual before you operate your Everlast unit. This manual is not only for the use of the machine, but is intended to assist you in obtaining the best performance out of your unit. Do not operate the unit until you have read this manual and you are thoroughly familiar with the safe operation of the unit.

If you feel you need more information please contact Everlast Support at 877-755-9353 ext. 207 or email at support@everlastwelders.com

The warranty does not cover improper use, maintenance or consumables. **Do not attempt to alter or defeat any piece or part of your unit, particularly any safety device.** Keep all shields and covers in place during unit operation should an unlikely failure of internal components result in the possible presence of sparks and explosions. If a failure occurs, discontinue further use until malfunctioning parts or accessories have been repaired or replaced by qualified personnel.



Note on High Frequency electromagnetic disturbances:

Certain welding and cutting processes generate High Frequency (HF) waves. These waves may disturb sensitive electronic equipment such as televisions, radios, computers, cell phones, and related equipment. High Frequency may also interfere with fluorescent lights. Consult with a **licensed** electrician if disturbance is noted. Sometimes, improper wire routing or poor shielding may be the cause.



HF can interfere with pacemakers. See EMF warnings in following safety section for further information. Always consult your physician before entering an area known to have welding or cutting equipment if you have a pacemaker.

Safety Precautions



These safety precautions are for protection of safety and health. Failure to follow these guidelines may result in serious injury or death. Be careful to read and follow all cautions and warnings. Protect yourself and others.



Welding and cutting processes produce high levels of ultraviolet (UV) radiation that can cause severe skin burn and damage. There are other potential hazards involved with welding such as severe burns and respiratory related illnesses. Therefore observe the following to minimize potential accidents and injury:



Use appropriate safety glasses with wrap around shields while in the work area, even under welding helmets to protect your eyes from flying sparks and debris. When chipping slag or grinding, goggles and face shields may be required.



When welding or cutting, always use an approved shielding device, with the correct shade of filter installed. Always use a welding helmet in good condition. Discard any broken or cracked filters or helmets. Using broken or cracked filters or helmets can cause severe eye injury and burn. Filter shades of no less than shade 5 for cutting and no less than shade 9 for welding are highly recommended. Shades greater than 9 may be required for high amperage welds. Keep filter lenses clean and clear for maximum visibility. It is also advisable to consult with your eye doctor should you wear contacts for corrective vision before you wear them while welding.



Do not allow personnel to watch or observe the welding or cutting operation unless fully protected by a filter screen, protective curtains or equivalent protective equipment. If no protection is available, exclude them from the work area. Even brief exposure to the rays from the welding arc can damage unprotected eyes.



Always wear hearing protection because welding and cutting can be extremely noisy. Ear protection is necessary to prevent hearing loss. Even prolonged low levels of noise has been known to create long term hearing damage. Hearing protection also further protects against hot sparks and debris from entering the ear canal and doing harm.



Always wear personal protective clothing. Flame proof clothing is required at all times. Sparks and hot metal can lodge in pockets, hems and cuffs. Make sure loose clothing is tucked in neatly. Leather aprons and jackets are recommended. Suitable welding jackets and coats may be purchased made from fire proof material from welding supply stores. Discard any burned or frayed clothing. Keep clothing away from oil, grease and flammable liquids.



Leather boots or steel toed leather boots with rubber bottoms are required for adequate foot protection. Canvas, polyester and other man made materials often found in shoes will either burn or melt. Rubber or other non conductive soles are necessary to help protect from electrical shock.



Flame proof and insulated gauntlet gloves are required whether welding or cutting or handling metal. Simple work gloves for the garden or chore work are not sufficient. Gauntlet type welding gloves are available from your local welding supply companies. Never attempt to weld with out gloves. Welding with out gloves can result in serious burns and electrical shock. If your hand or body parts comes into contact with the arc of a plasma cutter or welder, instant and serious burns will occur. **Proper hand protection is required at all times when working with welding or cutting machines!**

Safety Precautions



WARNING! Persons with pacemakers should not weld, cut or be in the welding area until they consult with their physician. Some pacemakers are sensitive to EMF radiation and could severely malfunction while welding or while being in the vicinity of someone welding. *Serious injury or death may occur!*



Welding and plasma cutting processes generate electro-magnetic fields and radiation. While the effects of EMF radiation are not known, it is suspected that there may be some harm from long term exposure to electromagnetic fields. Therefore, certain precautions should be taken to minimize exposure:

- Lay welding leads and lines neatly away from the body.
- Never coil cables around the body.
- Secure cables with tape if necessary to keep from the body.
- Keep all cables and leads on the same side the body.
- Never stand between cables or leads.
- Keep as far away from the power source (welder) as possible while welding.
- Never stand between the ground clamp and the torch.
- Keep the ground clamp grounded as close to the weld or cut as possible.



Welding and cutting processes pose certain inhalation risks. Be sure to follow any guidelines from your chosen consumable and electrode suppliers regarding possible need for respiratory equipment while welding or cutting. Always weld with adequate ventilation. Never weld in closed rooms or confined spaces. Fumes and gases released while welding or cutting may be poisonous. Take precautions at all times.

Any burning of the eyes, nose or throat are signs that you need to increase ventilation.

- Stop immediately and relocate work if necessary until adequate ventilation is obtained.
- Stop work completely and seek medical help if irritation and discomfort persists.



WARNING! Do not weld on galvanized steel, stainless steel, beryllium, titanium, copper, cadmium, lead or zinc without proper respiratory equipment and or ventilation.



WARNING! This product when used for welding or cutting produces fumes and gases which contains chemicals known to the State of California to cause birth defects and in some cases cancer.

(California Safety and Health Code §25249.5 *et seq.*)



WARNING! Do not weld or cut around Chlorinated solvents or degreasing areas. Release of Phosgene gas can be deadly. Consider all chemicals to have potential deadly results if welded on or near metal containing residual amounts of chemicals.



Keep all cylinders upright and chained to a wall or appropriate holding pen. Certain regulations regarding high pressure cylinders can be obtained from OSHA or local regulatory agency. Consult also with your welding supply company in your area for further recommendations. The regulatory changes are frequent so keep informed.



All cylinders have a potential explosion hazard. When not in use, keep capped and closed. Store chained so that overturn is not likely. Transporting cylinders incorrectly can lead to an explosion. Do not attempt to adapt regulators to fit cylinders. Do not use faulty regulators. Do not allow cylinders to come into contact with work piece or work. Do not weld or strike arcs on cylinders. Keep cylinders away from direct heat, flame and sparks.

Safety Precautions



WARNING! Electrical shock can kill. Make sure all electrical equipment is properly grounded. Do not use frayed, cut or otherwise damaged cables and leads. Do not stand, lean or rest on ground clamp. Do not stand in water or damp areas while welding or cutting. Keep work surface dry. Do not use welder or plasma cutter in the rain or in extremely humid conditions. Use dry rubber soled shoes and dry gloves when welding or cutting to insulate against electrical shock. Turn machine on or off only with gloved hand. Keep all parts of the body insulated from work, and work tables. Keep away from direct contact with skin against work. If tight or close quarters necessitates standing or resting on work piece, insulate with dry boards and rubber mats designed to insulate the body from direct contact.



All work cables, leads, and hoses pose trip hazards. Be aware of their location and make sure all personnel in area are advised of their location. Taping or securing cables with appropriate restraints can help reduce trips and falls.



WARNING! Fire and explosions are real risks while welding or cutting. Always keep fire extinguishers close by and additionally a water hose or bucket of sand. Periodically check work area for smoldering embers or smoke. It is a good idea to have someone help watch for possible fires while you are welding. Sparks and hot metal may travel a long distance. They may go into cracks in walls and floors and start a fire that would not be immediately visible. Here are some things you can do to reduce the possibility of fire or explosion:

- Keep all combustible materials including rags and spare clothing away from area.
- Keep all flammable fuels and liquids stored separately from work area.
- Visually inspect work area when job is completed for the slightest traces of smoke or embers.
- If welding or cutting outside, make sure you are in a cleared off area, free from dry tender and debris that might start a forest or grass fire.
- Do not weld on tanks, drums or barrels that are closed, pressurized or anything that held flammable liquid or material.



Metal is hot after welding or cutting! Always use gloves and or tongs when handling hot pieces of metal. Remember to place hot metal on fire-proof surfaces after handling. Serious burns and injury can result if material is improperly handled.



WARNING! Faulty or poorly maintained equipment can cause injury or death. Proper maintenance is your responsibility. Make sure all equipment is properly maintained and serviced by qualified personnel. Do not abuse or misuse equipment.



Keep all covers in place. A faulty machine may shoot sparks or may have exploding parts. Touching uncovered parts inside machine can cause discharge of high amounts of electricity. **Do not allow employees to operate poorly serviced equipment.** Always check condition of equipment thoroughly before start up. Disconnect unit from power source before any service attempt is made and for long term storage or electrical storms.



Further information can be obtained from The American Welding Society (AWS) that relates directly to safe welding and plasma cutting. Additionally, your local welding supply company may have additional pamphlets available concerning their products. Do not operate machinery until your are comfortable with proper operation and are able to assume inherent risks of cutting or welding.

PowerTIG 350 EXT Accessories



Qty	Accessory
1	26 Series TIG torch and cable
1	18 Series TIG torch and cable
1	Everlast 22k Ω Pedal
1	Heavy duty work clamp
1	Heavy duty electrode holder
1	Regulator and hose assy.

NOTE: Accessory and consumable appearance, style, length and quantity subject to change without notice.

Section 1

Introduction and Specifications

PowerTIG 350EXT TIG/Stick Welder	Specifications
Process	AC/DC GTAW-P/DC SMAW
Inverter Type	Digital Microprocessor Controlled, IGBT Module
Minimum/Maximum Rated Output TIG	DC 5A/10.2V– 350 A/24V AC 10A/10.4V– 350 A/240V
Minimum/Maximum Rated Output Stick (DC Only)	20 A/20.8V - 270 A/24V
Start Type	Solid State HF and Lift Start
HF Point Gap	Heavy Duty Carbon Contact with .029”-.039” gap
TIG Duty Cycle @ Rated Amps/Volts	35% @ 350A/24V 60% @ 280A/21.2V 100% @ 210A/18.4V
Stick Duty Cycle @ Rated Amps/Volts	35% @ 270A/30.8V 60% @ 210A/ 28.4V 100% @ 160A/26.4V
OCV (U _o) TIG/Stick	80V/80V
Voltage Input (U _i)	240 V; 50/60Hz 1 phase
Maximum Inrush Amps (I _{1MAX})	47A @ 240V
Maximum Operating Amps (I _{1EFF})	29A @ 240V
Gas Pre-Flow /Post Flow Time	0-25 Seconds/ 0-50 Seconds
Start Amps/End Amps	Start: 5-350A DC, 10-350 AC End: 5-350A DC; 10-350A AC
Up/Down Slope	0-25/0-25 Seconds
AC Wave Forms	Advanced Square, Soft Square, Sine, and Triangular
AC Frequency Control	20-250 Hz
AC Balance Control	5-90% of Electrode Positive (EP +)
Pulse Frequency Hz (Pulses Per Second)	Standard AC/DC 11-500 Hz Advanced Square Wave (Mix) .1-10 Hz
Pulse Amps (Ratio)	5-95%
Pulse Time On (Balance)	3-100%
Spot Timer Control	YES
Stick Arc Force Control	0-100%
Stick Surge Amp Control (Hot Start Intensity)	0-100%
Stick Surge Amp Duration (Hot Start Time)	0-2.0 Seconds
Minimum Water Ingress Protection Standard	IP21S
Cooling Method	Fan with full time running
Dimensions (approximate)	25” H X 11.5” W X 25” L
Weight (Bare Unit)	83 lbs
AC Easy Start Parameters (Default)	AC Frequency : 120Hz AC Balance: 25% Preflow: .5 Post Flow: 4 Seconds Amps: 120 A (with pedal) Start amps: 50A End amps 50 A Upslope: 1 second, Downslope: 3 seconds, (2T with torch switch)
DC Easy Start Parameters (Default)	DC: Preflow .5 Postflow: 3 Seconds Amps: 90 A (with pedal) Start amps: 50 A End amps: 50A, Upslope: 1 second Downslope 3 seconds (2T with torch switch)
Minimum Generator Requirement*	11,500 Surge Watts 9500 Continuous Rated Watts

* Generator must be certified as a clean power unit by its manufacturer with less than 10% total harmonic distortion.

General overview. The 350 EXT TIG/Stick welder is the largest of the advanced digital models in a new generation of inverter welders from Everlast. With a micro-processor and IGBT module design, the welder offers stable arc performance as well as convenient setup and use. Key features include:

- A. IGBT modules, microprocessor controller and an overall plug and play design improve reliability and reduces down time for service and repair.
- B. Full bridge design features soft switching technology which further extends IGBT component life and extends its capabilities.
- C. Heavy-Duty High Frequency design for arc starting has improved arc initiation at low amperages.
- D. Features automatic over-voltage, over current and duty cycle protection (over-heat) with self diagnosing trouble code feature.
- E. Programmable memory stores favorite settings and remembers up to 9 stored programs.
- F. Arc force control, Hot Start time and Hot Start intensity controls expand stick welding ability.
- G. Four standard wave forms in AC offer increased aluminum capability.
- H. Advanced AC Pulse and Standard AC/DC pulse increase weld capability on thin or heat sensitive materials.
- I. Easy start-up feature offers simplified operation.

General Use and Care: This weld is good for use in many industrial environments such as ship yards, fabrication shops, pipelines. However, care should be taken to keep the unit out of direct contact with water spray. The unit is rated IP21S, which rates it for light contact with dripping water. It is a good idea to remove the welder from the vicinity of any water or moisture source to reduce the possibility of electrocution or shock. Never operate or weld in standing water.

Every 1-2 months, depending upon use, the welder should be unplugged, opened up and carefully cleaned with compressed air. Regular maintenance will extend help extend the life of the unit.

 **IMPORTANT: Before opening the unit for any reason, make sure the unit has been unplugged for at least 10 minutes to allow time for the capacitors to fully discharge. Severe shock and/or death can occur.**

Do not restrict air flow or movement of air around the welder. **Allow a buffer distance of 2 feet from all sides if possible, with a minimum distance of at least 18".** Do not operate the welder immediately in the weld

area or the force of the fan will cause welding issues such as unstable arc or porosity.

Do not mount in areas that are prone to severe shock or vibration. Lift and carry the welder by the handle.


Do not direct metallic dust or any dirt intentionally toward the machine, particularly during grinding and welding operations. Make sure the panel is protected from damage while welding and cutting operations by flipping down the clear protective cover.

Duty Cycle. For the 350 EXT, the duty cycle is rated for 35% at 350 Amps (TIG) and 35% at 270 Amps for Stick. The duty cycle is based off a 10 minute duty cycle rating at 40° C. This means that the unit is capable of being operated at the stated amps for 3.5 minutes out of every 10 minutes without a break for cooling down the unit. This does NOT mean that the 350EXT can work 35% of any longer length of time. A full rest, with the unit running (switched on) and no welding taking place should be given to the welder for the balance of the 10 minute period for maximum life, if operating at or near maximum output capacity. Overheat, over current, over voltage and under voltage faults are indicated by a warning light accompanied with an error code. Do not operate the unit until the cause of the problem has been determined and corrected. Do not shut down an overheated welder until it has safely cooled. Once the overheat condition has had time to clear, welding can resume when the power switch is cycled on and back off. Do not operate this welder with the protective covers removed. In case of other troubles follow the trouble diagnosis section and/or call Everlast Technical support.

This manual has been compiled to give an overview of operation and is designed to offer information centered around safe, practical use of the welder by a person with at least some welding experience and/or knowledge. This manual is not designed as a primer on welding and is not exhaustive in content. Keep in mind that welding is inherently dangerous. Only the operator of this welder can ensure that safe operating practices are followed, through the exercise of common sense practices and safety training. Do not operate this machine until you have fully read the manual, including points of safety. **If you do not have the skill, and/or knowledge to safely operate this welder, do not use this welder until formal training regarding safe operation of this welder has been received.**


QUICK SETUP GUIDE: TIG CONNECTIONS

NOTE: The TIG torch will always be negative polarity whether DC or AC!

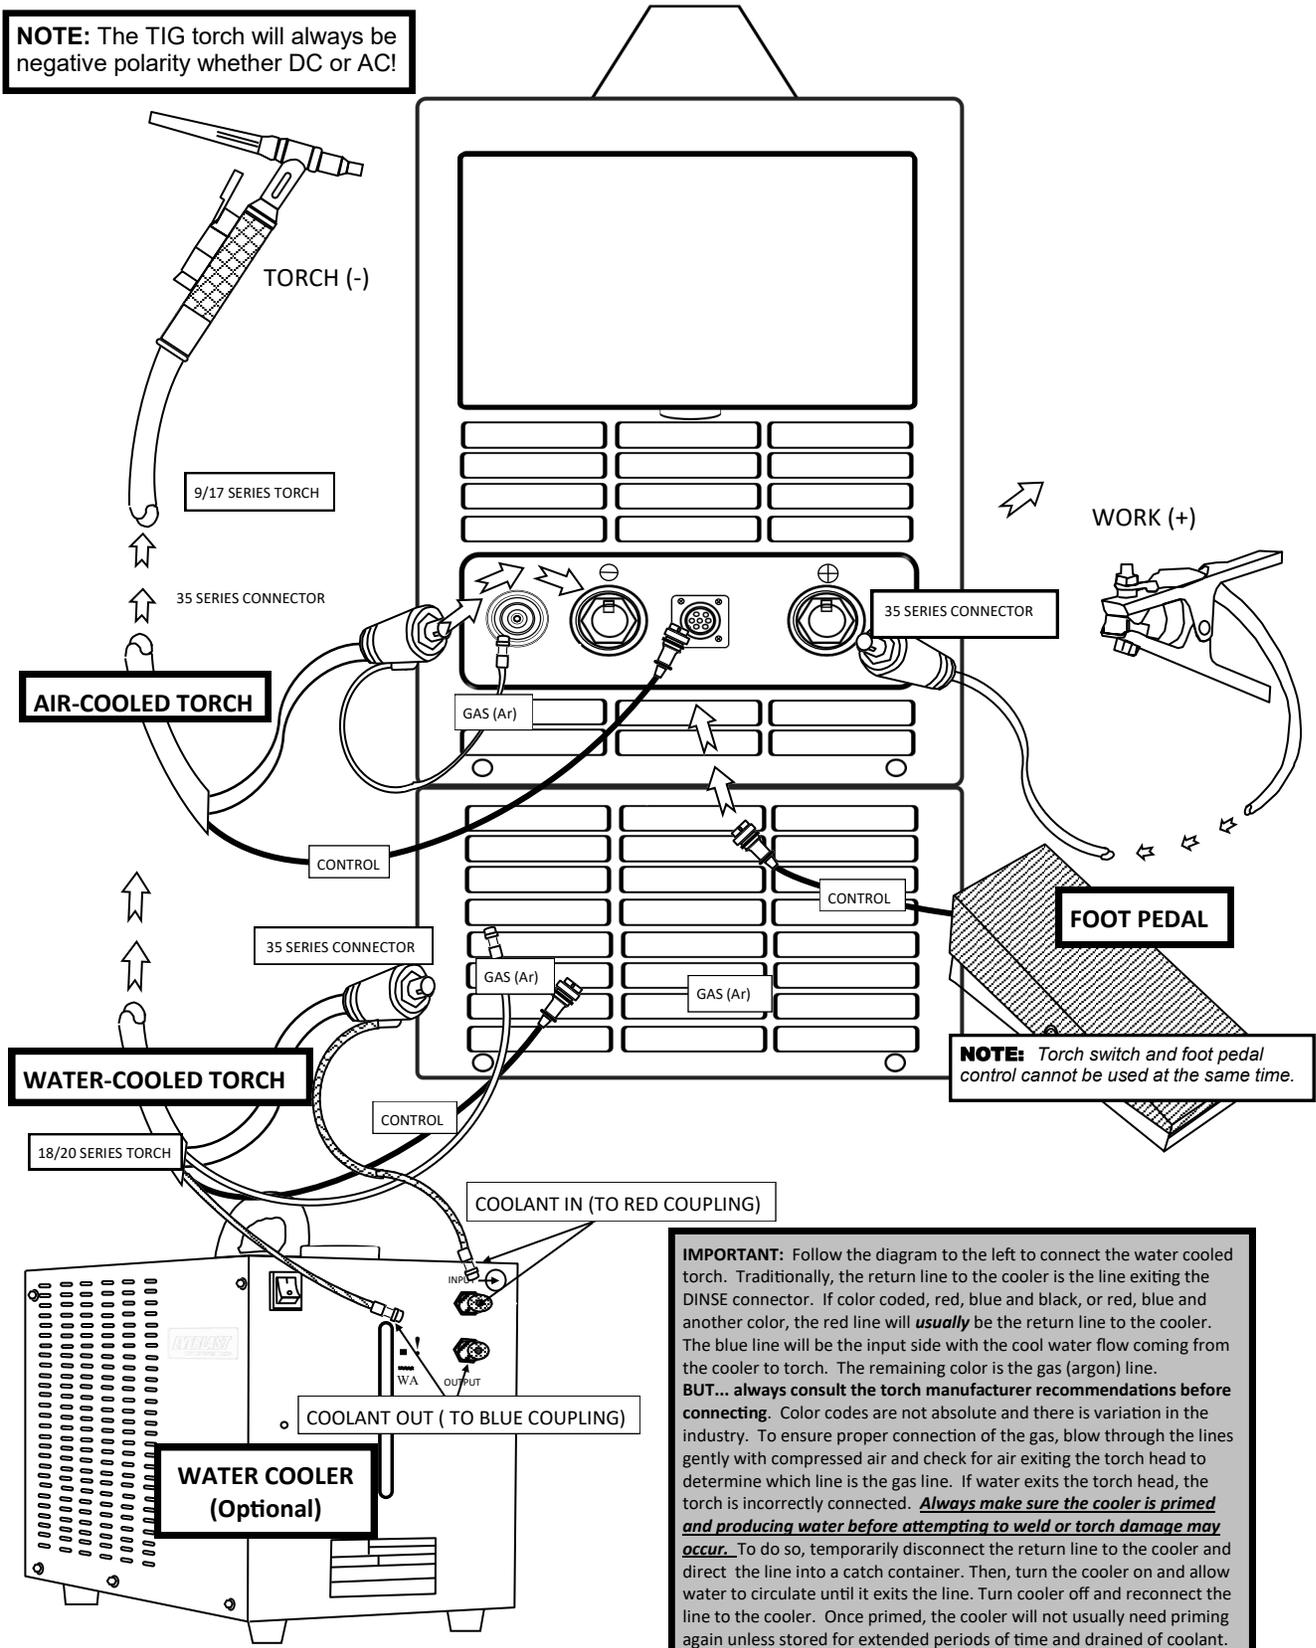


NOTE: Torch switch and foot pedal control cannot be used at the same time.

IMPORTANT: Follow the diagram to the left to connect the water cooled torch. Traditionally, the return line to the cooler is the line exiting the DINSE connector. If color coded, red, blue and black, or red, blue and another color, the red line will *usually* be the return line to the cooler. The blue line will be the input side with the cool water flow coming from the cooler to torch. The remaining color is the gas (argon) line. **BUT... always consult the torch manufacturer recommendations before connecting.** Color codes are not absolute and there is variation in the industry. To ensure proper connection of the gas, blow through the lines gently with compressed air and check for air exiting the torch head to determine which line is the gas line. If water exits the torch head, the torch is incorrectly connected. ***Always make sure the cooler is primed and producing water before attempting to weld or torch damage may occur.*** To do so, temporarily disconnect the return line to the cooler and direct the line into a catch container. Then, turn the cooler on and allow water to circulate until it exits the line. Turn cooler off and reconnect the line to the cooler. Once primed, the cooler will not usually need priming again unless stored for extended periods of time and drained of coolant.

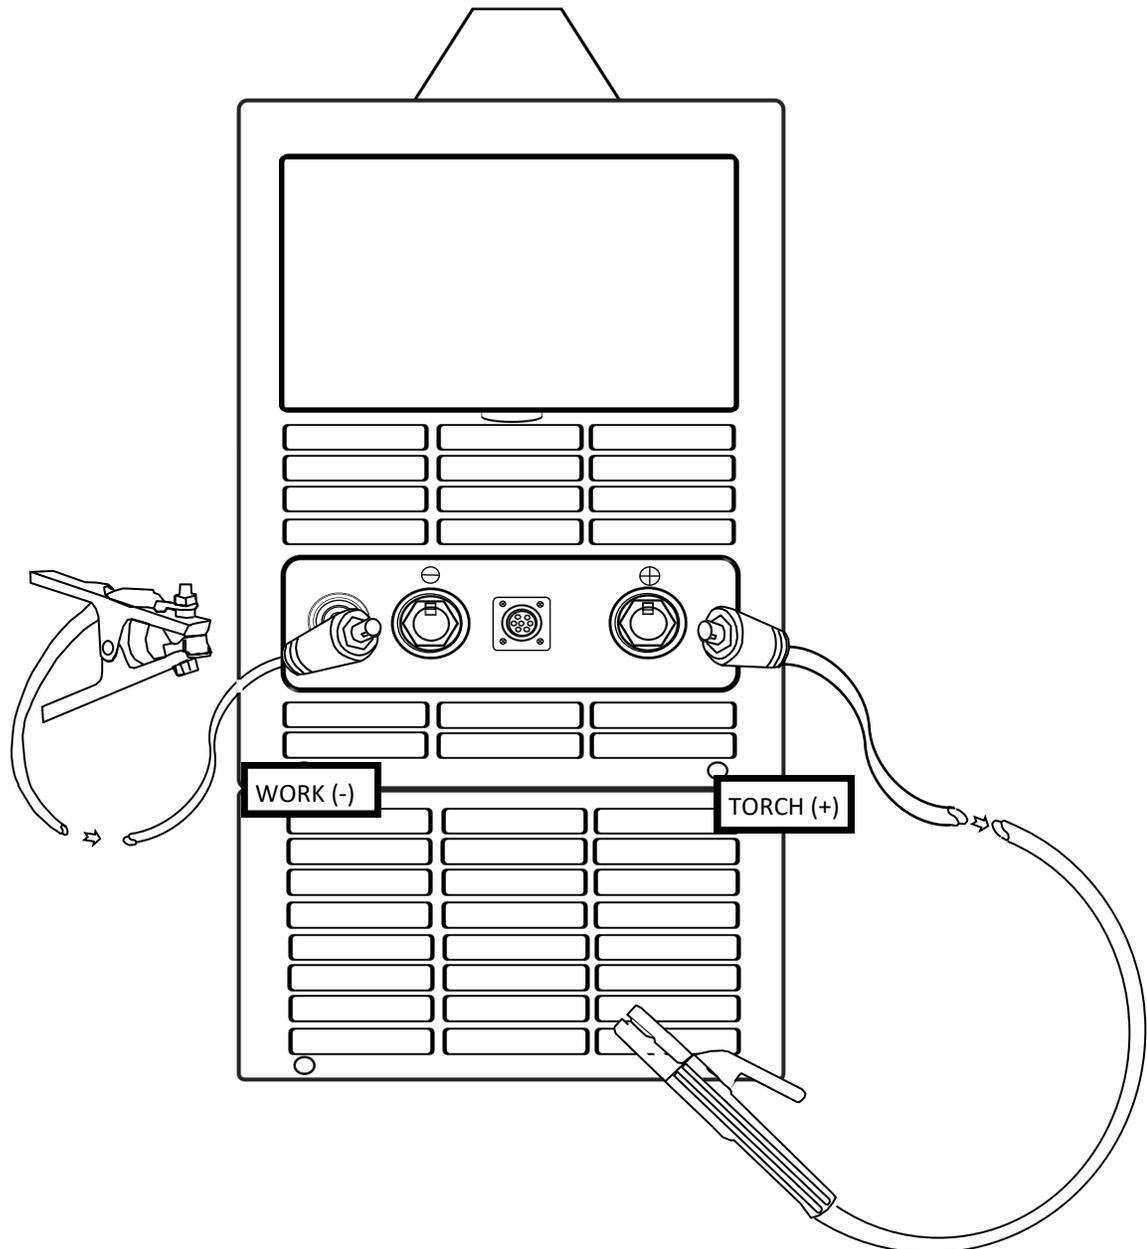
QUICK SETUP GUIDE: STICK POLARITY AND CONNECTIONS

NOTE: In stick mode, the polarity will almost always be positive, except for special rods or circumstances. Consult the electrode manufacturer packaging material or website for proper polarity with specialty rods and for conditions where electrode negative would be appropriate. ***When changing over to TIG weld, do not forget to check and change the polarity. This is a common error which prompts many technical support inquiries.***

QUICK SETUP GUIDE: REAR CONNECTIONS AND WIRING (US/Canada)

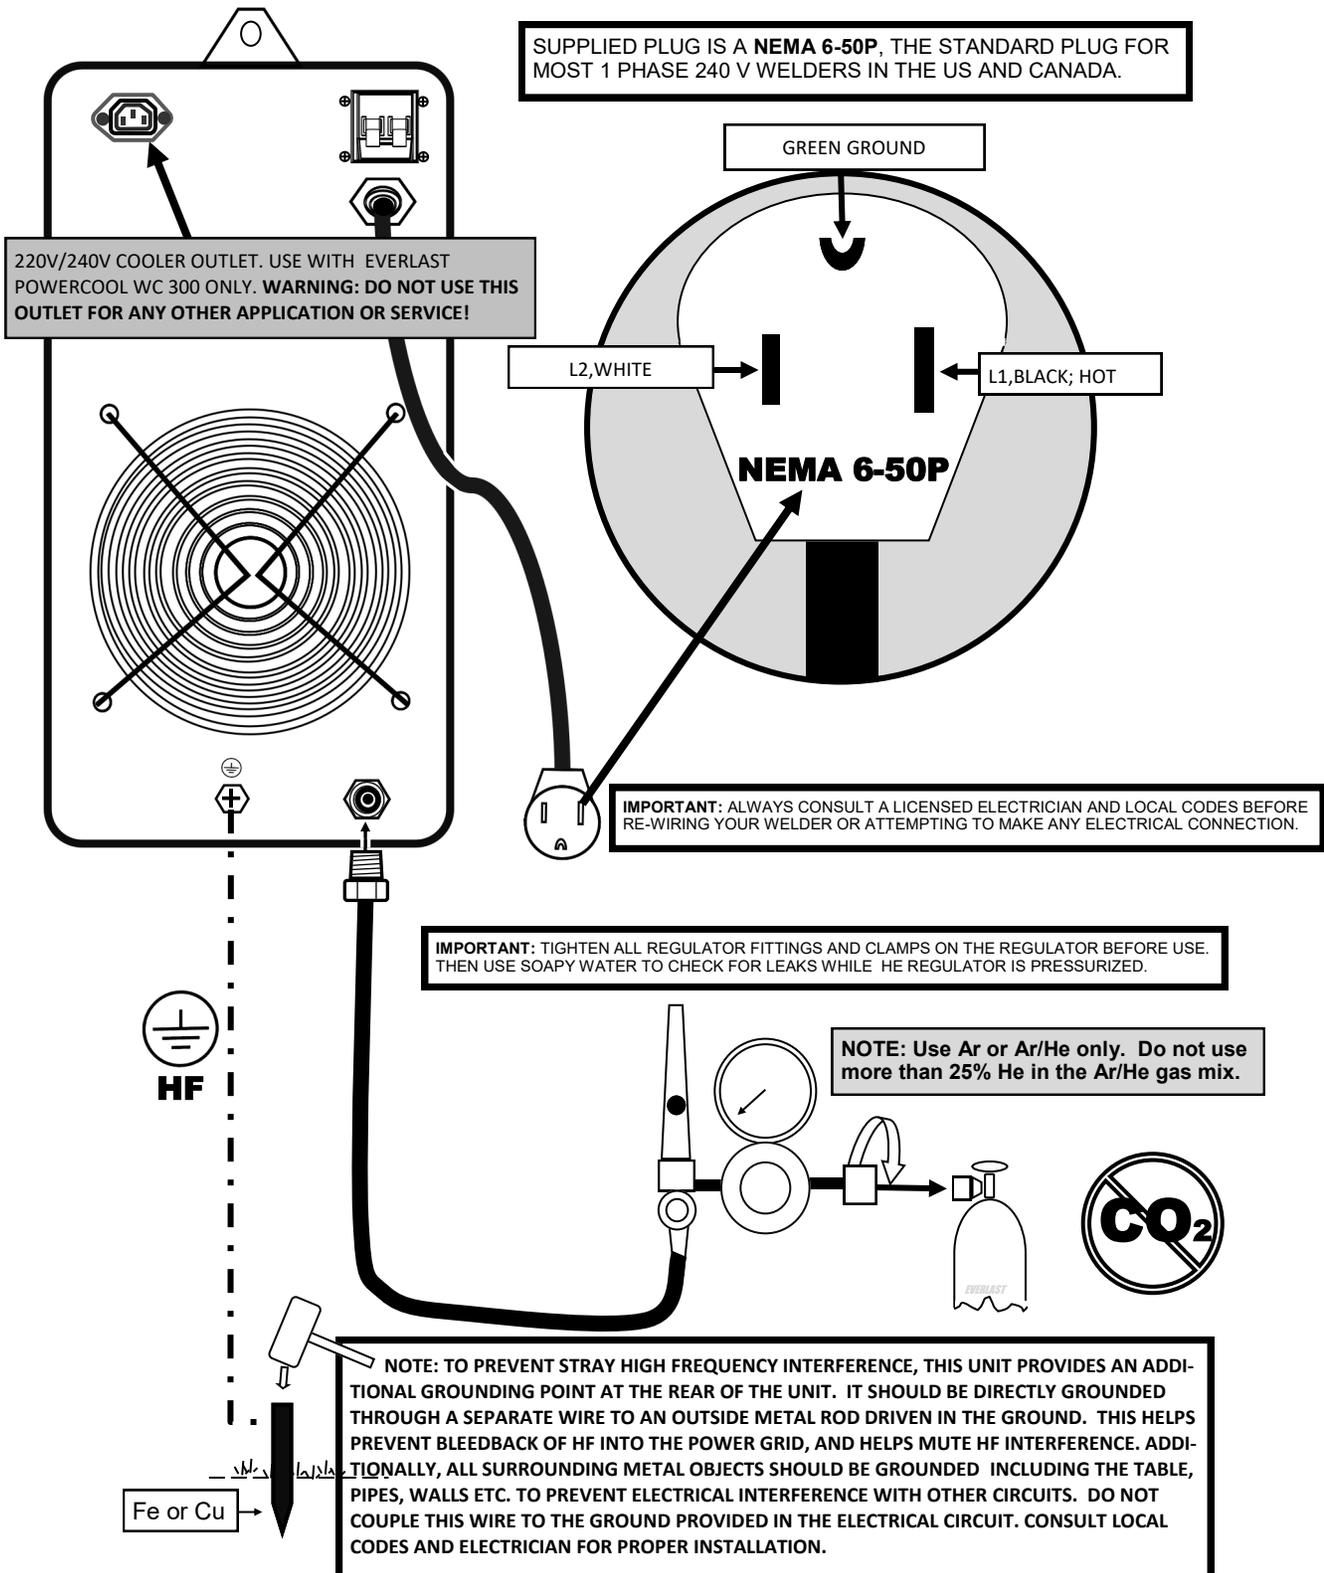

FRONT PANEL FEATURES AND CONTROLS POWERTIG 350 EXT

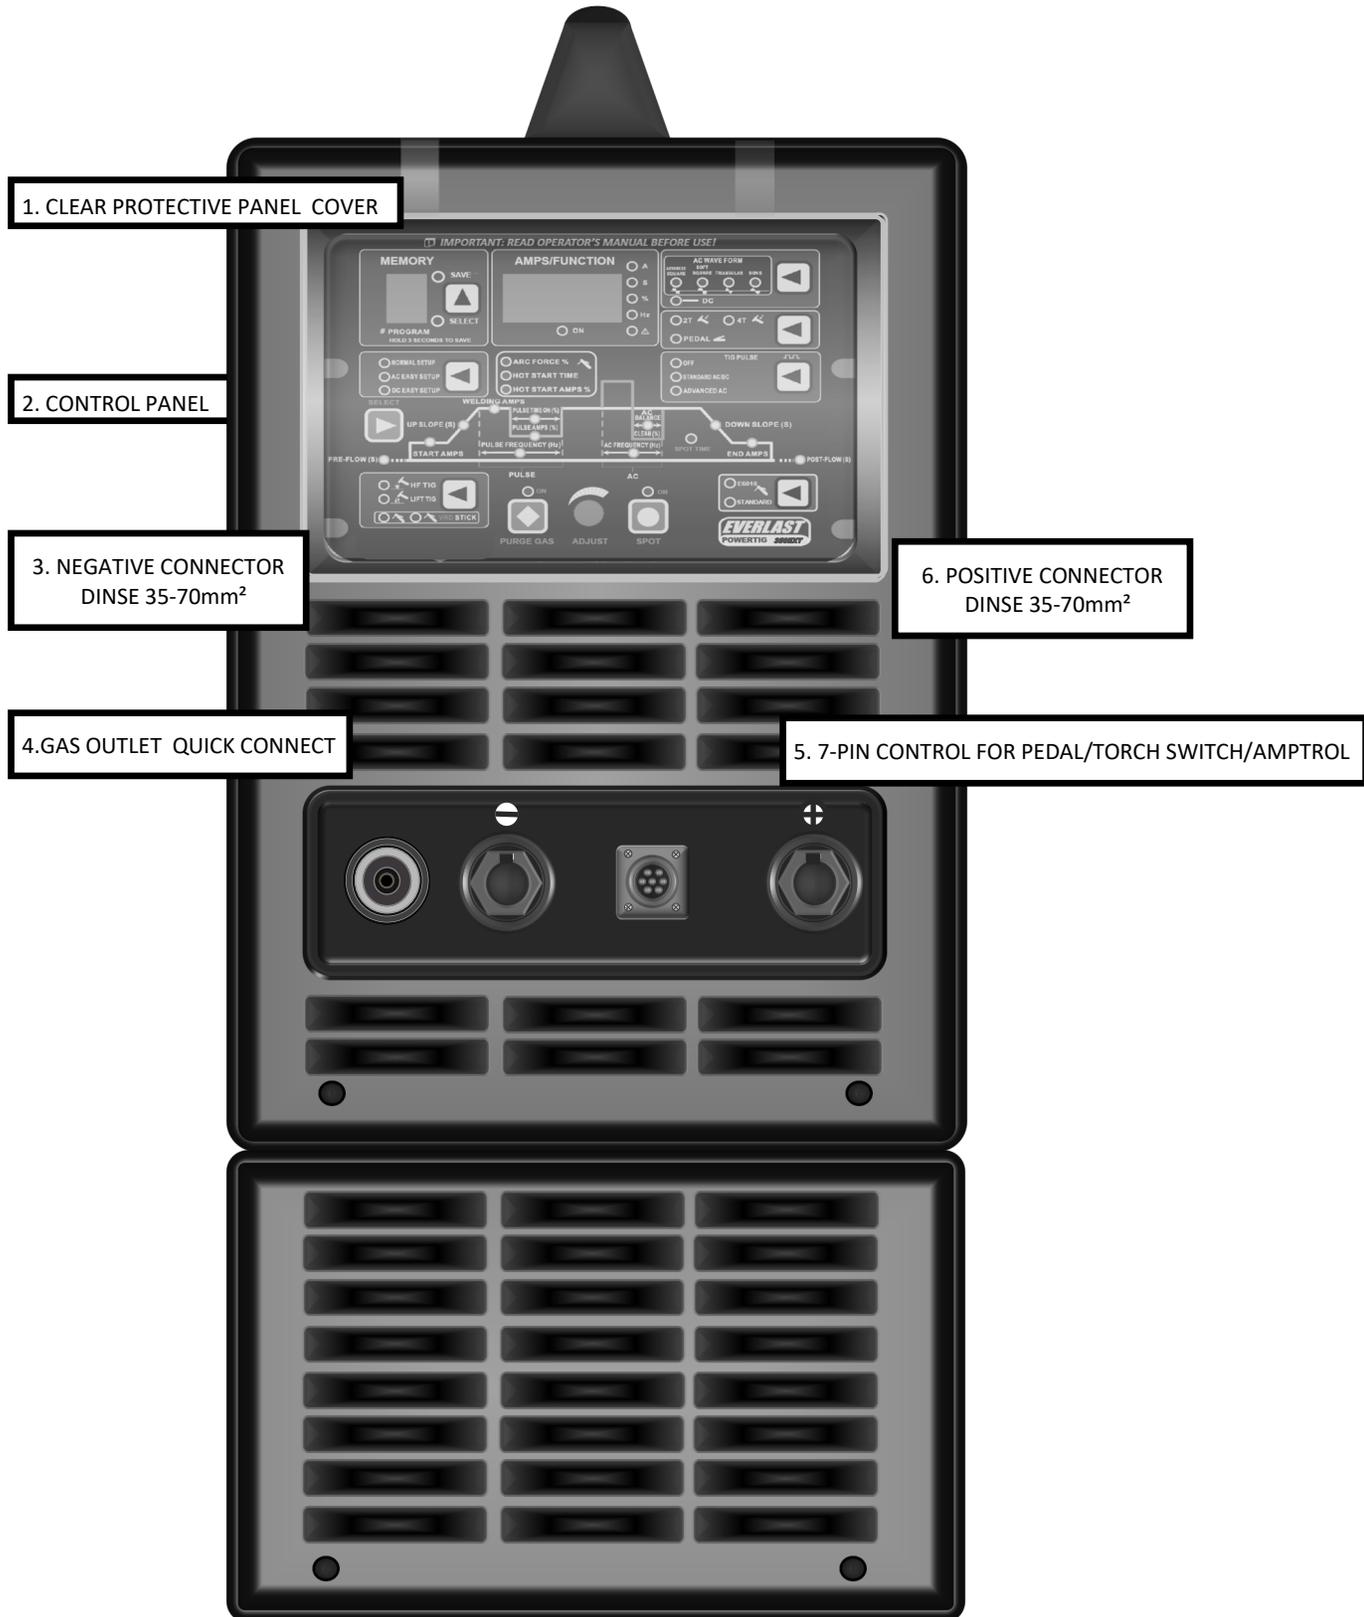

1. CLEAR PROTECTIVE PANEL COVER

2. CONTROL PANEL

3. NEGATIVE CONNECTOR
DINSE 35-70mm²

4. GAS OUTLET QUICK CONNECT

5. 7-PIN CONTROL FOR PEDAL/TORCH SWITCH/AMPTROL


6. POSITIVE CONNECTOR
DINSE 35-70mm²

FRONT PANEL FEATURES AND CONTROLS POWERTIG 350 EXT

POWERTIG 350 EXT	PARAMETERS	PURPOSE
1. Protective Cover	N/A	Clear hinged cover protects panel from damage. Keep closed during welding operations.
2. Main Control Panel	Digital	The main control features digital adjustment. It offers features that include Easy Start Up, Pulse, Advanced AC pulse, Stick welding feature, VRD Stick welding feature, Stick Hot Start, Arc force control, Lift start Tig, HF start TIG, 2T/4T/Pedal/Amptrol Control, and error code diagnosis.
3. Negative Connector	DINSE 35-70mm ²	Location of the negative terminal connection. This is a standard 35 series connector. For Stick: Work clamp Connection. For TIG: Torch connection.
4. Gas Outlet Quick Connect	9mm	Connects the gas to the TIG torch. To connect: Push the torch fitting into the connector until the collar slides forward with a click. To Release: Slide the outer collar back.
5. Control Connector	7 Pin (Panasonic type)	Connect the foot pedal, amptrol or torch switch to this socket to control the welder. Only one control connector can be plugged in at one time. If the torch has a torch switch feature or hand amptrol feature, tie the loose connector back or leave it hanging while using the pedal.
6. Positive Connector	DINSE 35-70mm ²	Location of the positive terminal connection. This is a standard 35 series connector. For Stick: Torch Connection (most electrodes). For TIG: Work Clamp Connection.

NOTES:

FRONT PANEL FEATURES AND CONTROLS POWERTIG 350 EXT

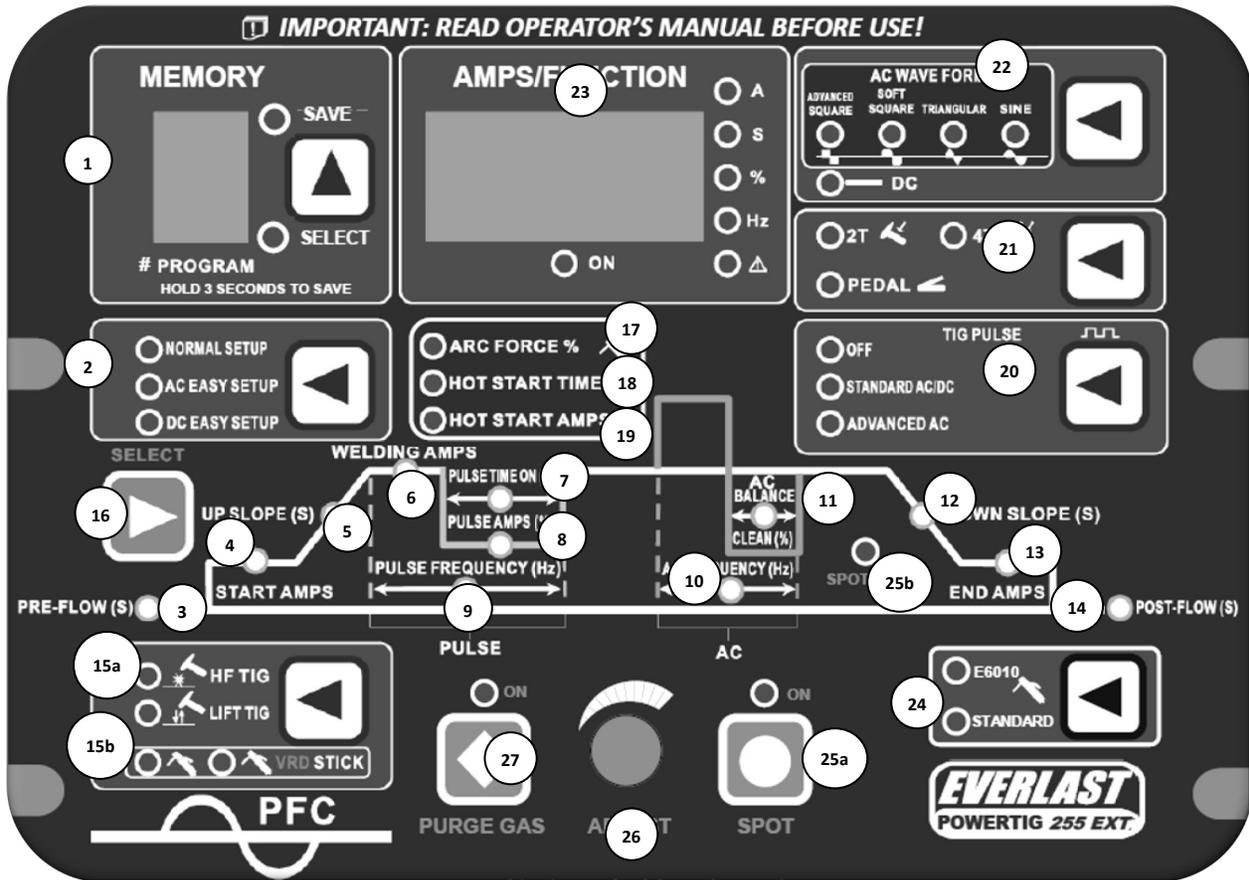

POWERTIG 350 EXT	PARAMETERS	PURPOSE
1. Memory Function	1-9	The unit has 9 programs which allow the operator to select parameters and then save the settings to the selected program channel. To operate, use the selector button to select the desired program number where the program is to be assigned. The red select light will be lit, indicating that the welder is in the programming mode. Enter the desired program parameters. After all parameter changes have been made, press the selector button and hold for 3 seconds and release. The green save button will light, indicating the function has been saved. After approximately 2 seconds, the save light will go out, and the unit will default back to the red select light. Any additional adjustment made after this will need to be resaved.
2. Easy Start Up Menu	Normal, AC and DC	The welder includes two Easy Start Up modes, one for AC and one for DC. The Easy Start Up features for AC and DC have been pre-programmed with parameters that are generally usable in most situations. Most parameter adjustments are blocked and are non-adjustable in these modes. Amperage and control functions are adjustable. Select Normal to allow standard setup. Suited for quick welds and repairs or novice use.
3. Pre-Flow	0-25 Seconds	Pre-Flow sets the gas flow time before the arc starts after the trigger or pedal is pressed. Used to purge the torch and flood the weld area with shielding gas so the arc start is stable and weld is free from porosity. Use enough time so that first blast of argon is settled (usually, about .3-.5 seconds). Note: Preflow will delay the arc start by the amount of time set.
4. Start Amps	120V: 5-120A (AC/DC) 240V: 5-250 A (AC/DC)	Serves as the 2T/4T initial amp value at the time of arc initiation while using the foot pedal, torch switch or amptrol. This allows the arc to be initiated at a different amp value than the selected maximum or minimum welding amps. Typically, this used to start the weld puddle more quickly. This feature is usually turned to the minimum amp setting (5 amps) while the foot pedal is in use. However, it can be used to create a "hot" start with the pedal to remedy starting issues at low amperages with larger tungsten and resolve heat dissipation issues.

FRONT PANEL FEATURES AND CONTROLS POWERTIG 350EXT

POWERTIG 350EXT	PARAMETERS	PURPOSE
5. Upslope	0-25 Seconds	Upslope ramps “up” from the start amp value to the welding amp value while starting the weld puddle. For best operation, the value will be automatically be set to 0 with standard foot pedal mode. NOTE: While in pedal mode, the select button will still cycle through the upslope and downslope settings. But, any adjustment made to the slope settings will automatically be overridden and zeroed out by the welder. If control over the slope while in pedal mode is needed, select pedal mode with 2T also highlighted. This will then allow slope to be set and adjusted. Pedal 4T mode will also allow adjustment of slope, but is not recommended for use with a standard foot pedal.
6. Welding Amps	AC: 10-350 Amps DC: 5-350 Amps	Welding amps are the maximum (peak) amp value that the user selects for welding. Used with the foot pedal and amptrol, this is the maximum amp value that can be reached with the foot pedal. Used with the torch switch, this is the destination current or maximum selected current of the sequencer. When used with pulse, Welding Amps represents the peak amps of the pulse. In advanced AC pulse mode, welding amps is designated as the AC portion of the pulse which is also the peak amps portion of the advanced pulse.
7. Pulse Time On (Balance)	5-95% of Welding Amp (Peak) Time	Defines the duty cycle (balance) of the pulse, by dividing or skewing the amount of time the pulse stays in the lower or upper stage of the pulse. The pulse consists of two stages: Welding amps (upper /Peak) and Pulse amps (lower/background current). This is represented by a % of total time the pulse spends in the welding amp stage of the cycle during one full pulse. The feature can be used to increase or decrease pulse amp time relative to the welding amp time of the cycle to help manage heat input. This feature functions the same in both Standard and Advanced AC pulse modes.
8. Pulse Amps (%)	5-100% of Welding amps	Pulse amps governs the background current (base amps) during the pulse cycle as a percent of welding amps. In Advanced AC Pulse mode this also represents the DCEN (electrode negative) which is the background current of the pulse cycle. In other words, the pulse amps parameter actually represents a drop in amps.
9. Pulse Frequency , Hertz (Pulses per second)	DC: .1-500 Hz AC Advanced Square: .1-250Hz AC Soft Square: .1-10 Hz AC Triangular: .1-10 Hz AC Sine: .1-10 Hz Advanced AC Pulse: .1-10 Hz	Represented by Hertz (Hz), the pulse frequency defines the actual number of times each second the pulse makes one complete cycle between welding amps (peak/high amp value) and pulse amps (background/low amp value). This is also commonly referred to as Pulses Per Second (PPS). Low pulse frequencies are ideal for timing the point where filler metal is added. This helps improve appearance and uniformity. Higher pulse frequencies are useful for welding seams and edges of thin material. Also it is useful for overall control of heat input for while welding thicker metals. Higher pulse frequencies are highly useful for automated welding processes. WARNING: WELDING AT HIGH PULSE FREQUENCIES INCREASES THE DECIBEL /NOISE LEVEL OF THE ARC. HEARING PROTECTION IS HIGHLY RECOMMENDED! In Advanced mode, the function of the frequency is essentially the same, and represents the number of times per second that the welder cycles completely between AC and DC.
10. AC Frequency	20-250 Hz	Governs the number of times per second that the current alternates in AC mode. To achieve greater arc focus (constriction) and increase puddle agitation while welding in AC mode, increase AC frequency. This allows pinpoint use on thin materials, and helps penetration on thicker materials. Ideal adjustment range is usually between 100-150 Hertz. For comparison most transformer welders in the US operate on 60 Hz. Greater arc control and stability can be achieved through the higher frequency range offered by this welder. Lower Frequencies will widen and soften the arc and reduce the level of control. WARNING: INCREASING THE AC FREQUENCY ALSO INCREASES THE DECIBEL/NOISE LEVEL OF THE AC WELDING ARC. HEARING PROTECTION SHOULD BE WORN!
11. AC Balance	10-90% of EP	Defines the percent of Electrode Positive (EP) used during AC welding to provide cleaning action. This divides the time that the AC cycle spends in Electrode Positive or Electrode Negative during one full AC cycle. It controls the amount of cleaning and penetration via a ratio to achieve the best balance while welding on AC. Too much cleaning action will result in tungsten balling or splitting. Too little cleaning can result in dirty, sooty welds and even a dull weld appearance. Simply put, as the percent increases, greater cleaning will occur, but less penetration will be achieved. NOTE: This is expressed as a percent of full Electrode Positive polarity. This unit uses 100% Electrode Positive as the reference, which is opposite (a reciprocal value) from some other brands of TIG welders with this adjustment. Using the welder in excess of 50% EP can ball and vaporize the tungsten. For most welds, no more than 45% cleaning is needed. Ideally, start with 30% EP for a reference point and then fine tune the cleaning by adjusting up or down in increments of 5%.


FRONT PANEL FEATURES AND CONTROLS POWERTIG 350EXT

POWERTIG 350 EXT	PARAMETERS	PURPOSE
12. Down Slope	0-25 Seconds	Down Slope will ramp amps “down” from the welding amp value to the end amp value to give time to fill the crater left at the end of the weld bead. For best operation, value should be set to 0 with foot pedal in use. If used with a hand amptrol, without a separate switch to control slope in 2T/4T mode, then the upslope should be set to 0 as well. When using the foot pedal or amptrol without a separate control switch, the arc may flare at the end of the weld after the weld has been lowered to the minimum amp level if the value has not been set to 0. Can also be used in the 4T mode to help with heat control by briefly tapping the switch to cool off the weld before tapping it again to restart the up slope sequence before the arc reaches the end amp stage.
13. End Amps	AC: 10-350 Amps DC: 5-350 Amps	Sets the final or minimum current before the arc is terminated. Used for filling craters at the ends of the weld and crack prevention. When using the foot pedal, this should be set to the lowest amp value (3 for DC; 5 for AC) or arc may suddenly get hot at the end of the weld.
14. Post Flow	0-50 Seconds	Controls the amount of time in seconds that the argon flows after the arc has terminated. Provides proper shielding during cooling to prevent rapid oxidation of the weld which results in porosity. Use 1-2 seconds post flow time for every 10 amps.
15a. HF TIG/ Lift TIG/ Stick/ VRD Stick Process Selector	N/A	This selects TIG or stick mode. It also selects the type of TIG start. The Process selector offers the choice of Lift Tig (for DC only) which requires contact with the metal to initiate the arc and High Frequency Start which allows non contact starting of the arc (for AC and DC). When in HF mode, the unit relies upon a gapless solid state HF module to start the arc, which is a more reliable and trouble free design than traditional point gap HF design. The lift start function on the EXT models provides a cold electrode for safety, and prevents accidental starts. This requires that the pedal or torch switch must be used to energize the arc. HF refers to the start type only. The inverter design of the welder eliminates the need for a constant HF overlay in AC.
15b. HF TIG/ Lift TIG/ Stick/ VRD Stick Process Selector	N/A	This selects the stick process or the VRD stick process. A Voltage Reduction Devices (VRD) is required in some situations to reduce the risk of electrocution. The VRD reduces the Open Circuit Voltage (OCV) below 20 volts (±3V) for safer operation until the arc is struck and low resistance is sensed. The VRD can make starting more difficult in some situations, and requires a brief contact with the metal to start the weld. Rusty metals, or painted surfaces may make starting more difficult by offering too high of a resistance value for the unit to sense an arc strike attempt. When using the VRD Stick mode, a slight delay in arc starting may be noticed. A firm scratching action may be necessary.
16. Parameter Selector	N/A	The push button selector is used to scroll left to right through different panel settings.
17. Arc Force Control (DIG)	0-100%	Controls the arc response when an arc is held short and voltage begins to drop. Arc force automatically compensates by modifying the volt/amp curve to maintain the energy needed to weld. Represented as a percent of available arc force amperage.
18. Hot Start Time (Surge Amp Time)	0-2 Seconds	Sets the length of time that the Hot Start is active while starting the arc. Used to reduce sticking of the electrode during the arc strike phase.
19. Hot Start Amps %	0-100%	Controls the “hot” start amperage during the initial contact of the electrode. It makes arc starting easier by sending a surge of amps briefly while arc is struck to prevent sticking. The % represents the percent of additional hot start amps available.
21. TIG Pulse Mode Selector	Pulse OFF Standard Pulse Advanced AC Pulse	The unit features two pulse modes. The standard mode is available in AC and DC modes. The Advanced AC mode, works only in AC. Pulse is used to control heat input on metals by pulsing amperage between a high (Peak) and low (Base or background) amp value. The high amp stage is represented as Welding Amps. The low amp stage is represented as Pulse Amps. The Advanced AC pulse pulses between AC and DC– polarity to control heat input on thin aluminum. In advanced mode, AC is assigned the welding amps stage of the pulse, and DC– is assigned the pulse amps stage of the pulse. Both the standard and Advanced pulse modes have the same features of pulse time on, pulse frequency and pulse amps. Other than changing the polarity in Advanced AC pulse mode, the two pulses are similar in adjustment.

FRONT PANEL FEATURES AND CONTROLS POWERTIG 255EXT

POWERTIG 255EXT	PARAMETERS	PURPOSE
21. 2T/4T/ Pedal Selector	2T, 4T, Pedal, Pedal with 2T, Pedal with 4T	This selects the operation of the torch switch, pedal, or hand amptrol. To weld with the torch switch, select 2T or 4T. For 2T operation, simply press and hold the switch. The panel program will cycle automatically. When the switch is released, the arc will downslope and terminate with post gas flow. When in 4T mode, the switch is pressed, and held to start the pre-flow and the start amps part of the cycle. When released, upslope begins and continues until the amps are raised to the preset welding amps. When pressed and held again, downslope starts and ramps down to the end amp stage (crater current). When released, the arc terminates, and post flow begins. If desired, before the downslope finishes, the switch may be tapped again to start the up slope again. To operate with the foot pedal, select pedal mode. The features such as start amps, upslope, down slope, and end amps will function with the pedal. Be sure to lower these features to the minimum values when the foot pedal is in use, unless a desired effect is needed. The start amp feature can be particularly useful as a brief "hot start" tig setting which provides an initial burst of amps to be to rapidly develop a puddle. To operate with a hand amptrol, select Pedal, and then press the selector additionally to select the 2T or 4T feature light. Both the Pedal and the 2T or 4T pedal will be lit. The starting and ending of the arc will be the same as the standard 2T or 4T mode, except the amps can be adjusted while welding with the amptrol. However, some amptrols have only a a switch that is built into the amptrol mechanism, and is not controllable independently of the amperage. When this type of amptrol is used, the unit should be placed into standard pedal mode for proper operation.
22. AC Waveform/DC Selector	DC AC Advanced Square Soft Square Triangular Sine	The unit features AC/DC operation, with 4 standard wave forms available in AC for specialized welding needs. The advanced square wave is the default mode and is the best all around mode with excellent wet in, and arc controllability. Soft Square wave and Sine wave mimic the feel and effect of the transformer welders. The Soft square wave is similar to Square wave transformers, and have a smooth, buttery feel, but maintains good control over the arc. The Sine wave is similar to much older sine wave transformer TIG welders. This offers the softest arc, and affords less control than other modes. The Triangular wave is designed for rapid wet in, and high speed travel on the metal. It also features rapid freeze of the puddle. DC mode is the standard mode used for all metals except aluminum and magnesium. Aluminum and Magnesium should be welded in AC only.
23. Data Display	Amps, Seconds Percent, Hertz Warning, On	The unit features a single main display. The data in the display is always accompanied by a corresponding LED light which indicates the function being represented. This also includes a self diagnosing function which displays an error code and a corresponding warning light.
24. Standard/6010 Selector	Standard	Select the "Standard" mode for all stick welding except cellulosic rods. For E6010, 6011, and other cellulosic rods select the default "6010" mode. This will improve arc performance and stability while using E6010 and similar rods. If arc seems harsh while welding E7018, E7024, E6013, E7014 or other similar rods, check to make sure "6010" mode is not engaged.
25. Spot Weld Timer	.5-25 Seconds	This is used to set the arc-on time while making spot and tack welds or other welds of a repetitive nature. To set the spot time, press the spot weld button (25a) so the LED above it is lit. Then, toggle the main select button until the spot weld light(25b) is lit up, and use the main control knob to increase or decrease time. To use, select 2T and use torch remote button. Press and hold the button to start the arc. The arc will automatically terminate after the preset length of time has expired. Upslope and Downslope can be used to taper the arc during long arc on times. However, if using for tacking, a 0 up slope and downslope time may provide the best tack weld results.
26. Parameter Adjuster	N/A	The control knob is used increase or decrease parameter values. To increase adjustment speed, push in on the knob while turning. It will then adjust by increments of 10.
27. Purge Gas	On/Off	This feature is used to set gas flow and provide additional, untimed post flow cooling. To set gas flow, press the touch panel button so the LED above it is lit. The gas should freely flow. Then adjust the gas flow via the regulator. Press the button again to return to normal operation of the solenoid valve. This bypasses the need to set post flow and cycling the pedal or torch switch briefly to get gas to flow. IMPORTANT: Do not forget to press button again to turn the gas flow off after setting the gas flow rate or using it to provide extra cooling.

REAR PANEL FEATURES AND CONTROLS 350 EXT

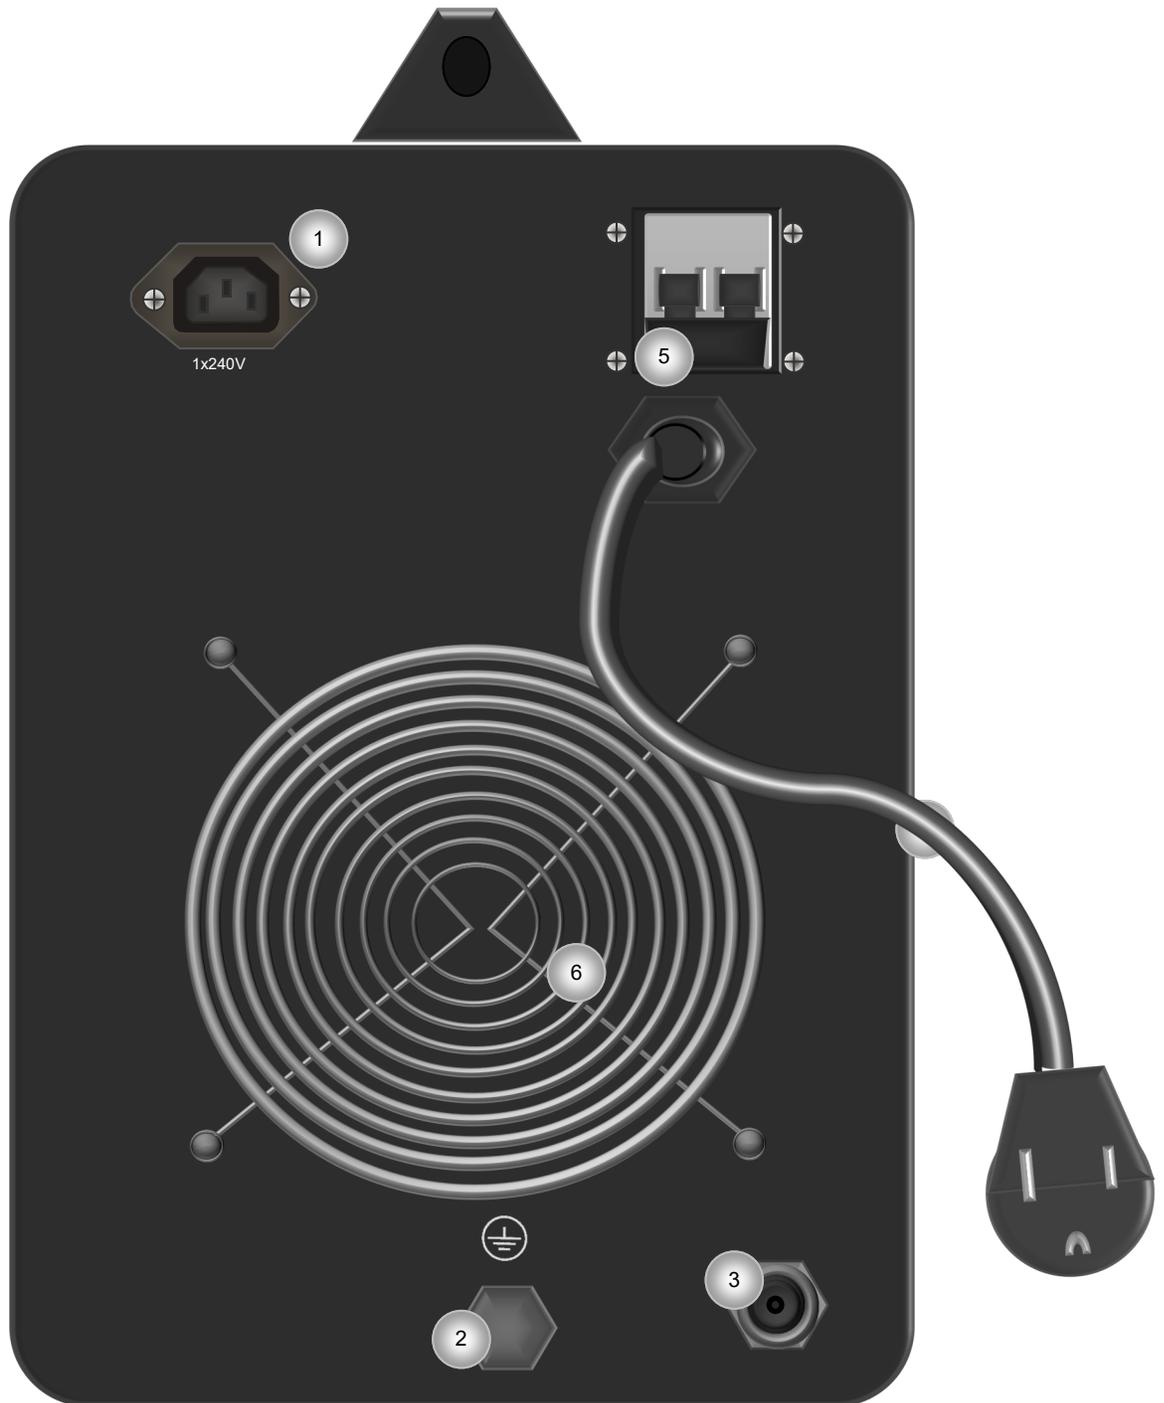


REAR PANEL FEATURES AND CONTROLS CONTINUED

POWERTIG 350 EXT	PARAMETERS	PURPOSE
1. Water Cooler Receptacle	IEC 60320-1 "C-14"	This connection supplies power to the Everlast PowerCool 300 water cooler and is designed specifically for it. This is a 220/240V AC 1 phase outlet. Do not use this connection to power any other device. 4 amp 240V maximum load. Do not alter this plug or attempt to modify in anyway.
2. HF Ground Bolt	N/A	HF energy can be devastating to surrounding electronic equipment. If the operating environment includes electronic equipment, this bolt can serve as a direct path to a grounded metal rod that is isolated from the main electrical circuit to help bleed off excess HF circuit. All metal parts inside the building should be grounded as well, including pipes, tables, and even metal siding. HF energy has been known to bleed back into the power grid and disrupt electronic devices further down the grid. If point gap becomes out of adjustment, more HF energy may build up, or even jump across circuitry within the welder. It is highly recommended that a small, separate ground wire be attached at this point while in use.
3. Gas Input Connection	1/4-5/16"	This is where the shielding gas from the regulator connects. The 5/8" CGA fitting is a standard fitting used in the US for inert shielding gas. If you suspect leaking, test the connection with a solution of mild soapy water. If bubbles are seen, retighten. Never connect any Ar/CO2 mixture to the welder. TIG uses only pure Argon or an Ar/He mixture. Do not use any other type of mix. Do not exceed 25% He for best starting results.
4. Power Cord	240 V 1 phase	The PowerTIG 350 EXT operates on 240V power(±10%). The unit uses a NEMA 6-50 plug for 240V power. This is a standard plug designated for welder use. NOTE: There is NO neutral in a standard 220V welder circuit. A welder circuit will only use three wires (two hot 110V power legs and one ground). Always consult a licensed electrician who is aware of local codes before attempting any wiring of the welder or of the power circuits. Everlast is not responsible for any miswiring or damage caused to the unit by incorrectly wiring the welder or related damage resulting from use with a water cooler not labeled for dual voltage use.
5. 2-Pole Power Switch	On/Off	The breaker switch contains 2 poles for power. It serves as the On/Off switch for the welder. Always turn the welder on and off by the switch first before using any disconnect. In single phase, only two poles are active.
6. Fan	Hi Speed, Continuous Run	This unit features a continuous run type fan. After using for extended periods, allow the fan to run up to 10 minutes to continue to cool the unit. This will help extend the service life of the unit. The fan runs continuously to optimize the duty cycle of the welder.


Welder Function Summary and Explanations.

1. *2T/4T/Pedal sequencer.* The 2T/4T feature allows operation of the welder without a foot pedal. In many circumstances, a foot pedal is not practical for use. So, the 2T/4T function has been created to allow programming of the welder to simulate the activities of the foot pedal while providing more accurate control. The “T” refers to the number of travels of the remote switch installed on the torch required to operate the programming. 2T is essentially a “press and hold” operation and all programming is cycled automatically. Releasing the switch begins the final stage of programming. 4T operates differently in the fact that each touch activates a different stage of the programming, allowing for greater control. Also, in 4T, while actually welding at full amps, no finger contact with the switch is required. Following the graphic lines below, you can visually trace and learn the activity and function of each part of the welding cycle. In either 2T or 4T operation the programming can be reset to “upslope” before reaching the end amp stage by pressing the switch once more. Setting a long down slope improves the use of this reset function. See the graphics below for further explanation. The up and down arrows indicate the switch travel direction.

2T Torch Operation Effect on Weld Cycle

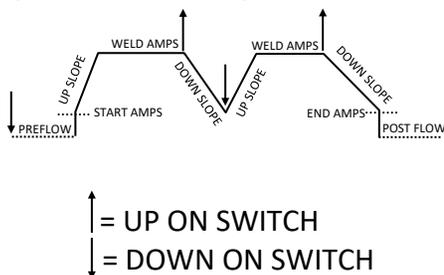

4T Torch Operation Effect on Weld Cycle

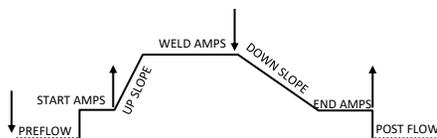

The standard pedal mode incorporates the same features of the sequencer. When used, it is similar in operation to the 2T mode with the same settings. However, all features except pre-flow and post flow would should be programmed for the minimum allowable value so the functions do not interfere with normal pedal operation. But if a TIG “hot start” is needed to improve arc transfer, or develop an instant puddle, the start amp feature can be used. Any other feature such as down slope can be used as well, for any special application or need. However, be sure to remember to reset these features to the minimum values when they are not required, or undesirable operation such as arc flares, sluggish operation may occur after releasing the foot pedal. With slider amp controls, and rotary/belt amp controls with built-in switches that activate when the control is moved, set the unit to “Pedal.”

NOTE: The welder features an additional 2T and 4T mode when the pedal light is on. This is actually designed for use with a hand amptrol (22k Ω). However, to work correctly, a torch switch must be used in conjunction with the amptrol to control the arc cycle. A momentary on/off button should mounted separately to activate the arc cycle if none is provided. Some aftermarket torch amptrols have a built in switch that automatically activates when the amptrol amperage is increased. In this case, the amptrol should be used in the foot pedal mode, or 2T pedal mode only depending upon amptrol switch configuration. Everlast sells torches with built in amptrols that are designed for use with our units in the amptrol 2T and 4T mode. Torches with both a separate torch switch and amptrol functions just as it would with the regular 2T or 4T cycle,




Everlast 26 series hand amptrol torch

except the amperage can be adjusted at the torch while welding, once the welding cycle has reached the normal welding stage of the cycle. P

2. *Easy Start Modes (AC and DC).* The unit is equipped with a separate AC and DC easy start mode. This mode allows the operator to get started welding quickly and easily without having to worry about correctly setting the unit up. The unit is preprogrammed for good, all around performance in either AC or DC modes. The amperage is preset, but can be adjusted if desired. Torch switch or pedal control can be selected, but most other features are locked into an optimized general purpose setting. This feature is useful for novice welders, and for customers wanting quick start up of the units without an extensive setup procedure.


3. *AC Wave Forms.* The wave form control is a useful feature for achieving a desired type of arc performance in AC mode. There are 4 wave forms to choose from. The standard, default wave form is the advanced square wave. This wave form is excellent for all types of welding, and offers quick puddle wet-in, and good arc stability. The triangular wave form is useful in situations where a fast freezing puddle is desired, particularly on thin aluminum. The soft square wave offers a buttery arc, with a smooth feel similar to the feel of a standard square wave transformer-based welder. The sine wave form mimics older transformer welders. This is the softest wave form, and offers less arc definition and control than other wave forms. This is preferred by some older more experienced welders. When using various wave forms, only the Advanced Square wave offers a relatively high pulse frequency, 250 Hz, in the standard pulse mode. All other wave forms are limited to a maximum of 10 Hz. Advanced pulse mode limits the pulse frequency to 10 Hz for other wave forms.

4. *AC Frequency.* The AC frequency only applies to the AC mode. Standard transformer welders typically have a fixed frequency of 60 Hz which is essentially the line input frequency supplied by the power company. But with inverters, the capability of AC frequency adjustment is practically limitless due to the IGBT components that create its own frequency. Frequency adjustment capability is useful to help improve directional control of the arc, and to focus the arc so that a narrower bead profile can be achieved. Also, at higher frequencies, the puddle agitation is greater which improve the breakup of undesirable oxides. All wave forms can be adjusted from 20-250 Hz

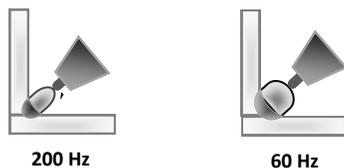


5. *AC Balance.* The AC output is formed by rapidly alternating polarity between electrode negative and electrode positive, creating something that resembles a wave when viewed on an oscilloscope. Normally, with standard transformer welders, both standard sine wave and even square wave welders


have little or no way to change the ratio of EN to EP, which results in welding with a molten ball at the tip of the tungsten and a less stable arc. Electrode negative (EN) provides penetration in the TIG welding process. Electrode positive (EP) creates a strong reverse flow of electricity that breaks up the weld-resistant oxidation that covers aluminum and magnesium components. It also places a lot of heat on the tungsten. In a “balanced” wave where both EP and EN are equal in time length (50%), penetration is reduced and over-cleaning results in wide etch lines running parallel to the side of the weld. Not all welds conditions will be alike so more cleaning is required at times than others. Similarly, more penetration will be required at times than others. Ordinarily, about 20-35% electrode positive is considered an ideal amount (65-75% electrode negative). This means that more heat is put into the work than on the tungsten and a sharper point can be used. Cleaning is still sufficient at that level. Good results can be achieved with about 30% EP or less. The cleaning action is still significant even at these levels. Ideally, the cleaning action should be adjusted until a small amount of frosting can be seen no more than 1/8” distance from the edge of the weld. If a piece of metal is particularly heavily oxidized or dirty, more cleaning action will be required. If too much cleaning action is used, the tungsten will begin to ball and may even start to burn away. If this much cleaning action is truly needed, then switch to a larger sized tungsten that can handle the increased heating level. Signs of too little cleaning action while welding aluminum are sooty, black or dull looking welds. A dedicated stainless brush and suitable aluminum cleaner such as acetone should still be used before welding any type of aluminum to help break up the heaviest oxide layer so less EP is needed and better penetration can be achieved. Even if the aluminum has a mirror like shine, it is still oxidized.

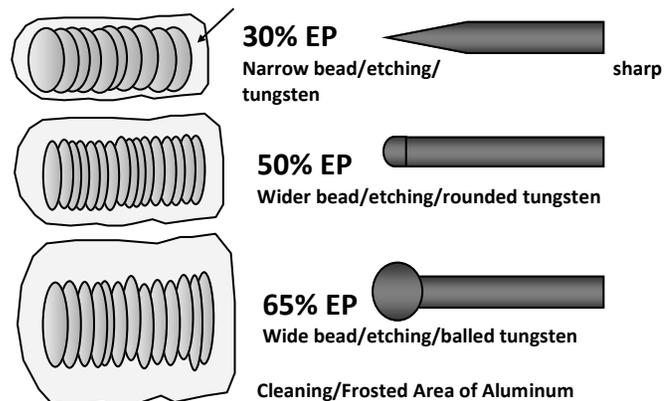


EXAMPLE: AC EP (+) BALANCE

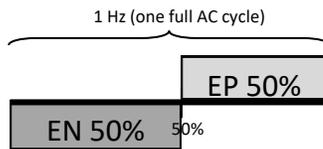

Standard transformer welder balance 50% EN/EP=
Balling tungsten, light penetration, wide cleaning area.



Extreme cleaning setting 65% EP=
Shallow penetration, balling tungsten, excessive cleaning area.



Good penetration setting 35% EP=
Deeper penetration, sharper tungsten, narrow cleaning area.

NOTE:

1. Due to the rapid switching of the inverter, High Frequency (HF) is not needed except to start the arc. The HF TIG feature only refers to the initial arc start, and can be used for DC as well. In a transformer welder, the HF can be switched to continuous to stabilize the AC arc. However, this is not needed in an inverter. Therefore, HF refers only to the initiation of the arc, and not to AC operation. However to reduce tungsten contamination with aluminum, you should only operate the AC mode with the HF start selected unless it is absolutely necessary to welding restrictions. Lift start is recommended only for DC, or for AC when a copper scratch block is used and the arc is transferred. Lift start would be used in areas that are sensitive to electronic interference such as hospitals or around computerized equipment such as CNC.
2. The addition of Helium to Argon can increase the welding capacity of the welder and alter the amount of cleaning typically needed. Do not exceed 25% however or arc starts will be difficult and erratic.
3. If arc wandering in AC is a problem, reduce cleaning percent. If it continues, reduce gas flow and then check for drafts or for poor work clamp connection. Also check for highly oxidized or dirty aluminum or a faulty work clamp or connection. Try relocating work clamp directly to the metal being welded.
4. AC controls only apply to AC operation, and do not affect the settings on DC.
5. Too slow of travel speed will increase the etching/cleaning area even if AC balance is turned low.

Parameter Notes:

Section 3

Basic Theory and Function

6. **Standard Pulse. (AC and DC)** The pulse creates two amp values, a high and a low value that cycle back and forth between each other while welding. The upper amperage is called the “welding amps” (sometimes called peak current) and the lower amperage is called “pulse amps” (sometimes called background or base current). This creates a situation where penetration can be achieved without overheating the metal, particularly on metals that are prone to structural deterioration or burn through. In effect you are creating an average of amps. The PowerTIG series feature three adjustable parameters concerning the pulse:

1. **Pulse Amps.** Both welding amps and pulse amps are independently set. Adjust the welding amps with the main control knob and the pulse amps with the pulse amp knob. However, when you adjust the pulse amps, you are actually defining a fixed ratio of amps. This is expressed as a percentage of Welding Amps. The display is not synchronized with the pulse so it samples at a set rate that is independent of pulse changes, which yields randomly fluctuating numbers. As you increase amperage, the pulse will maintain the same ratio of amps you have selected. To adjust the pulse amps to a desired setting using an example of 100 Welding Amps, setting the pulse amps to 50% would yield a 50 amp value for the pulse amps. The foot pedal will control both Welding Amps and Pulse Amps according to the %(Ratio) selected on the panel.


2. **Pulse Frequency.** Pulse speed or frequency as it is referred to is measured in the unit standard “Hertz”. Simply, it is the number of pulses per second that occur. Pulse frequency controls the arc constriction and also help with heat management.

3. **Pulse Time On (Balance).** Pulse Balance is the percentage (%) of time that the pulse stays in the welding amp stage of the cycle. Increasing the Pulse time on can increase the duration the welding amp stage of the cycle to increase the overall heat input. Pulse Balance is also commonly referred to as pulse duty cycle. For welding purposes, the term “Pulse Time On” is used as it deals with the sharing of on time between Peak and base amp values during one pulse cycle.

Setting up the pulse is not a process with a fixed adjustment procedure. Changes to frequency, balance, and time will skew the final result. A slow pulse with a equal 50% pulse time on and somewhere around a


EXAMPLE 1

**Welding Amps: 100 amps,
Pulse Amps: 50%
Pulse Time On: 50%
DC Pulse Frequency: 1 Hz**

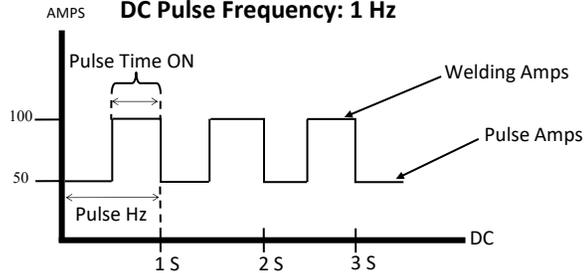


EXAMPLE 2

**Welding Amps: 100 amps
Pulse Amps: 50%
Pulse Time On : 50%
DC Pulse Frequency: 25Hz**

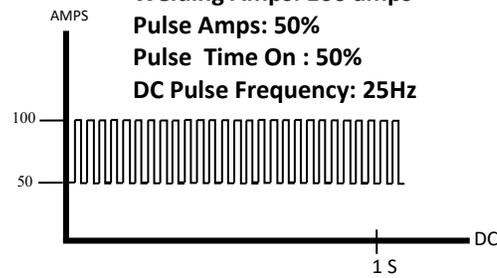


EXAMPLE 3

**Welding Amps: 100 amps
Pulse Amps: 25%
Pulse Time On: 75%
DC Pulse Frequency: 3 Hz**

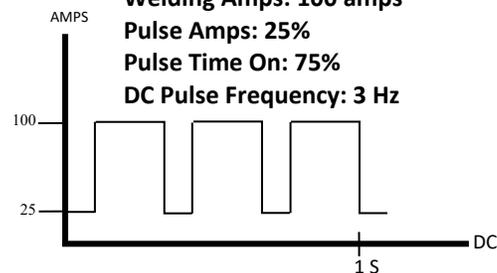

50-75% Pulse Amp setting is typically used to help with timing the addition of filler metal to the weld puddle. A higher pulse frequency level with variations in Pulse Time On and a narrow/wider ratio can be used to prevent burn through and speed up welding on thin materials. It can also help maintain a proper bead on a thin edge weld or prevent burn through on extremely thin metal. A fast pulse speed will make fine ripples in the weld while a slow pulse speed will give a much more coarse, but visually appealing result. There are limitless ways to adjust the pulse. Keep in mind though, that the basic purpose of the pulse is to average the heat input while maintaining penetration.

7. *Advanced Pulse (AC only)*. The Advanced Pulse is a feature not typically found on most pulse type TIG welders. In the “advanced” mode, the unit pulses current back and forth between AC and DC – polarity. This is designed primarily for use with welding aluminum, and is accessible only when used in AC mode. The purpose of Advanced Pulse mode is to create a quick freezing puddle, and offer more definition of the puddle ripples. It is also useful for controlling cleaning width, and for heat input control on thin gauge aluminum. AC is assigned as the welding amps setting (pulse peak), and the DC— is assigned as the pulse amps % (base value). Otherwise, the pulse frequency, and pulse time on are adjusted the same and perform the same function as the standard pulse mode adjustments. Occasionally during use, a slight wobble of the arc may be seen as it pulses between AC and DC—. This is usually observed if the frequency is set low and the metal is highly oxidized, the arc length is too long, or the work clamp is not connected securely. If this happens, readjust the work clamp, re-clean the metal and /or shorten the arc length. If pulsing slowly, the filler should be added on the audible AC stage of the pulse as this is the hotter stage of the pulse. **Note: The graph below has been simplified for clarity. It is designed to show the relationship and interaction between the AC and DC parts of the pulse and does not depict the effect of AC frequency cycling between — and + polarity during the pulse cycle.**

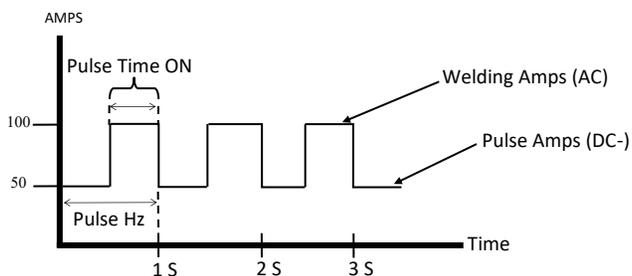

8. *Arc Force Control/Surge Amp Control*. When stick welding, arc force is used to help improve weldability of certain metals and welding rods. The arc force boosts current flow to match the demands of arc length and position. As an arc is held shorter, voltage tends to drop so extra amps are introduced to help maintain a steady arc. Surge amps boost the starting amperage briefly to heat up the welding electrode and weld area so the arc starts cleanly, without sticking or porosity. Both controls are inactive while welding in TIG mode.

9. *Foot Pedal. 22k Ω* . Select 2T on the panel. Select maximum amp value desired on the panel. The foot pedal will only control amps up to the range governed on the front panel. If more amperage is needed raise the amp level on the panel. The foot pedal also controls both Welding Amps and Pulse Amps through the ratio established by selecting the pulse Amp % on the panel. Welding with pulse and the foot pedal takes practice, as it will seem the welder is welding at less amps than it is. Always set the panel amps to about 25% more than what should be needed. Increasing the amps more than this margin on the panel will reduce the accuracy of the foot pedal by lowering the resolution of the foot pedal. Be sure to turn the start/end amps and up/down slope to the minimum setting or it will interfere with pedal operation. The pedal cannot override the start/end amp and slope controls. For more accurate and responsive control, Everlast offers a US made foot pedal available as an additional option. **Do not attempt to control stick function with the foot pedal.**

10. *Water-cooled and Air-cooled torches. (20/18 and 9/17/26 series)*. A water cooler is necessary for use with the water-cooled 18/20 series torches and to reach the maximum current potential of the unit. Using a water-cooled torch even briefly without water can seriously and permanently damage your torch. The Power Cool 300 may be purchased separately from Everlast which is designed to cool the torch up to the maximum amp capacity of the welder. If you are not have a water cooler or have not purchased a water cooler, you will need to use the air-cooled (gas-cooled) series torch that is included with the unit. Keep in mind that the 100% duty cycle mark on the Air cooled series is much lower and are usually rated for max amps at their 60% duty cycle mark. The air cooled torch may be used at slightly higher amperages but the torch duty cycle will be reduced and the potential to overheat and damage the torch exists. Overheated torches are not warrantable. All consumables should be interchangeable with other brand torches with similar designations ie xx26, xx17, or xx20. They should be available for local purchase.

Section 3

Basic Theory and Function

No special consumables are required. Although a small starter kit of consumables is included, you will need more consumables fairly quickly. These can be bought directly from Everlast in single pieces or in kits. But the consumables are not exclusive to Everlast and may be purchased locally at most any welding supply store which sell TIG welding supplies. **No Tungsten is included with the starter kit. Actual starter kit contents may vary. Everlast offers additional TIG kits with gas lenses and stubby kits which do include tungsten.**

the main adjustment knob while the Welding Amps light is lit. The unit will revert to the “setting” mode and display selected maximum amperage.

11. *DINSE style connector.* Everlast uses a 35-70mm² connector for both negative and positive connectors, which is a standard connector within the welding industry. This is commonly known as a 1/2” or 35 series DINSE-style connector. The connector allows the use of almost any brand or style of TIG torch.

12. *7 pin remote/foot pedal connector 22k.* This 7 pin connector is available from Everlast should it become damaged. See Pin-out reference found in the appendix of this manual.

13. *Argon quick connect.* This is a 9 mm size quick connect nipple. These are commonly available from Everlast or online sites which carry torches and fittings. Should you need a new one for your torch or damage yours, consult Everlast. Do not use a nipple that is scarred, bent or otherwise deformed. Damage to the female connector may result. Serious leaks may occur.


14. *Low amp starts.* The units have been configured to be able to start at approximately 5 amps DC, and 10 amps AC. Start Amps may also be increased for a “hot start” while in TIG mode if required. To attain the best quality low amp starts, you must reduce tungsten size and make sure the tungsten is pointed.

15. Argon Regulator. The argon regulator is listed in SCFH for North American markets. (subject to change).


NOTE ABOUT THE FOOT PEDAL MODE:

While using the foot pedal, and some hand amptrols, the welder’s digital display will revert back to the minimum amp setting on the welder after the arc is terminated and it will not display maximum set amps. It will only display maximum set amps while the unit is being adjusted for amperage. While welding the display will read actual weld amperage. After 3-4 seconds the display will default back to the minimum amp reading. When using 2T or 4T control modes, the amps will register the maximum set amps until the arc is started. To see the maximum set amperage in the pedal mode without the arc on, simply make a small adjustment in


TUNGSTEN PREPARATION

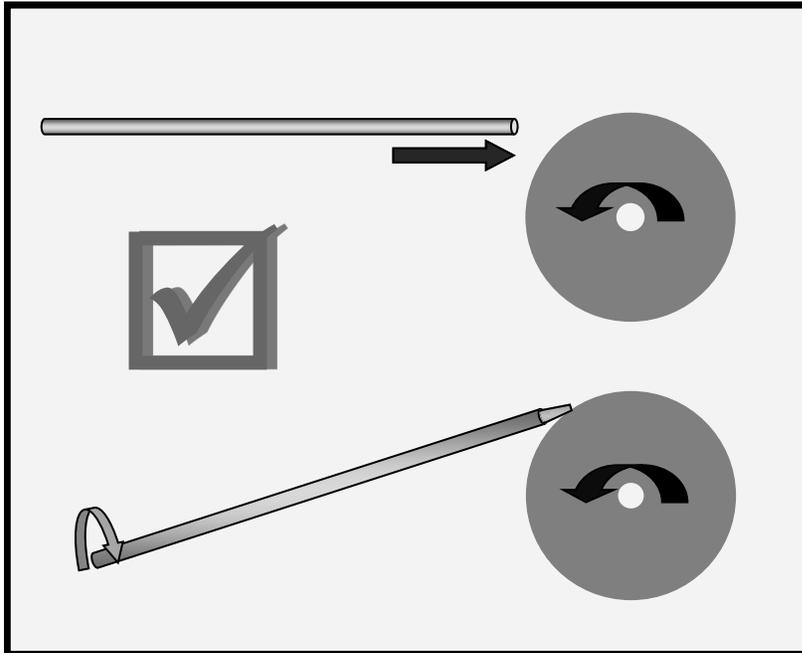


1. Use a dedicated grinding wheel or contamination may result. Do not breath grinding dust! Wear eye protection and gloves.
2. Hold Tungsten firmly.
3. Grind perpendicular to grinding wheel face. Allow tungsten to grind away slowly, creating point.
4. Rotate tungsten quickly as it is being ground to keep point even and symmetrical.

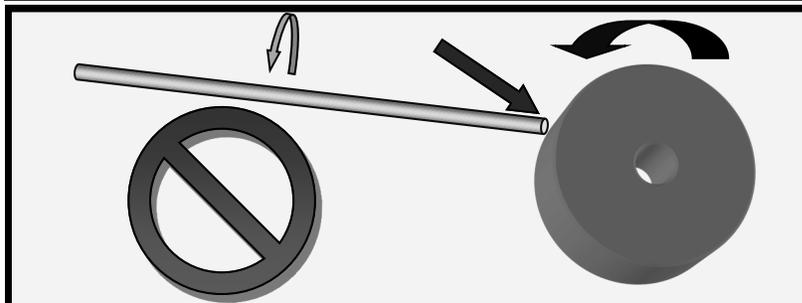

DO NOT GRIND TUNGSTEN PARALLEL TO WHEEL FACE OR AN UNSTABLE ARC WILL RESULT.

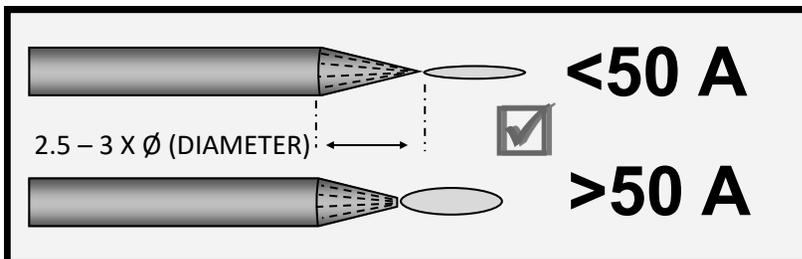

Use a point for low amp use to help control arc. Create a slight truncation on the tip for higher amp use for best arc stability. Grind the tip so that it is 2.5- 3 times longer than the tungsten is wide (Diameter).

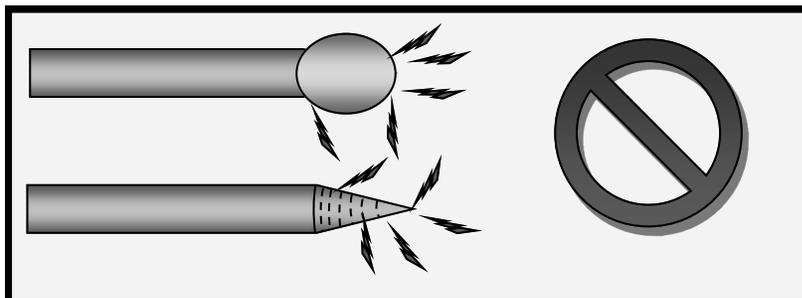

DO NOT BALL TUNGSTEN WHILE USING AC. ERRATIC ARC WILL RESULT. MAKE SURE GRINDING MARKS RUN PARALLEL TO TIP. CONCENTRIC MARKS WILL CAUSE ERRATIC ARC.

NEVER USE PURE (GREEN) TUNGSTEN IN AN INVERTER WELDER TO WELD ALUMINUM. SEE FOLLOWING RECOMMENDATIONS ABOUT TUNGSTEN SELECTION FOUND IN THIS MANUAL ON NEXT PAGE.

LIFT START TIG OPERATION

Note: A Lift TIG start should be done with a nearly seamless motion. Use a light touch and a quick motion for best results.

FOR DC USE. NOT RECOMMENDED FOR AC.

1. Position the edge of the ceramic cup on the metal. Press and hold the torch switch or press the foot pedal. Wait for the Pre-flow to start. (Make sure pre-flow is set for less than .5 seconds or start will be delayed.)
2. Quickly rotate cup so that the tungsten comes in brief contact (< .5 seconds) with the metal.
3. After contact with the metal, quickly rock the torch back so that the tungsten breaks contact with the metal.
4. An arc should form. As the arc grows, raise the cup up off the metal and slowly rotate the torch into welding position.
5. Leave 1/8" or less gap between the tungsten tip and the metal. Proceed with welding, leaving the torch inclined at a 15° angle.


HIGH FREQUENCY START TIG OPERATION

FOR AC OR DC USE.

1. Position the point of the sharpened tungsten about 1/8" or less above the metal.
2. Press the torch trigger or press the foot pedal to initiate the arc. The HF arc will be initiated. It may appear briefly as a blue spark.
3. An arc should form, almost immediately after the pre-flow cycle is completed. HF arc initiation will be delayed by the amount of pre-flow time used. If arc does not start after the pre-flow interval, and the HF is creating a spark, then check the work clamp contact with the work piece. Move the tungsten closer to the work. Repeat steps 1 and 2.
4. Leave 1/8" or less gap between the tungsten tip and the metal and proceed with welding, leaving the torch inclined at a 15° angle.

General Operation of TIG

1. Turn unit on, allow time for power up cycle to complete its start up process.
2. Select either HF or Lift Start TIG with the HF/Lift Start/Stick selector switch. Select DC mode .
3. Plug in Torch and select 4T or 2T mode with the selector **OR** plug in foot pedal and pedal with selector **OR** plug in amptrol and select pedal 2T or 4T.
4. If using the torch switch select start/end amps to increase or decrease amps for starting and ending the weld.
5. If using the torch switch, select up/ down slope to increase/decrease the ramp up or ramp down time of the amperage.
6. Adjust maximum amps to the recommended amperage. Generally use 1 amp per .001".
7. Start arc as depicted above.
8. If using 2T, continue to hold the torch switch until you are ready to stop welding. Release the switch. The Arc will then cease.
If using pedal raise foot fully off the pedal and arc will stop automatically.
9. If using 4T, release the switch, after arc initiates. Continue to weld without holding the switch down. To stop, press and release the switch again.

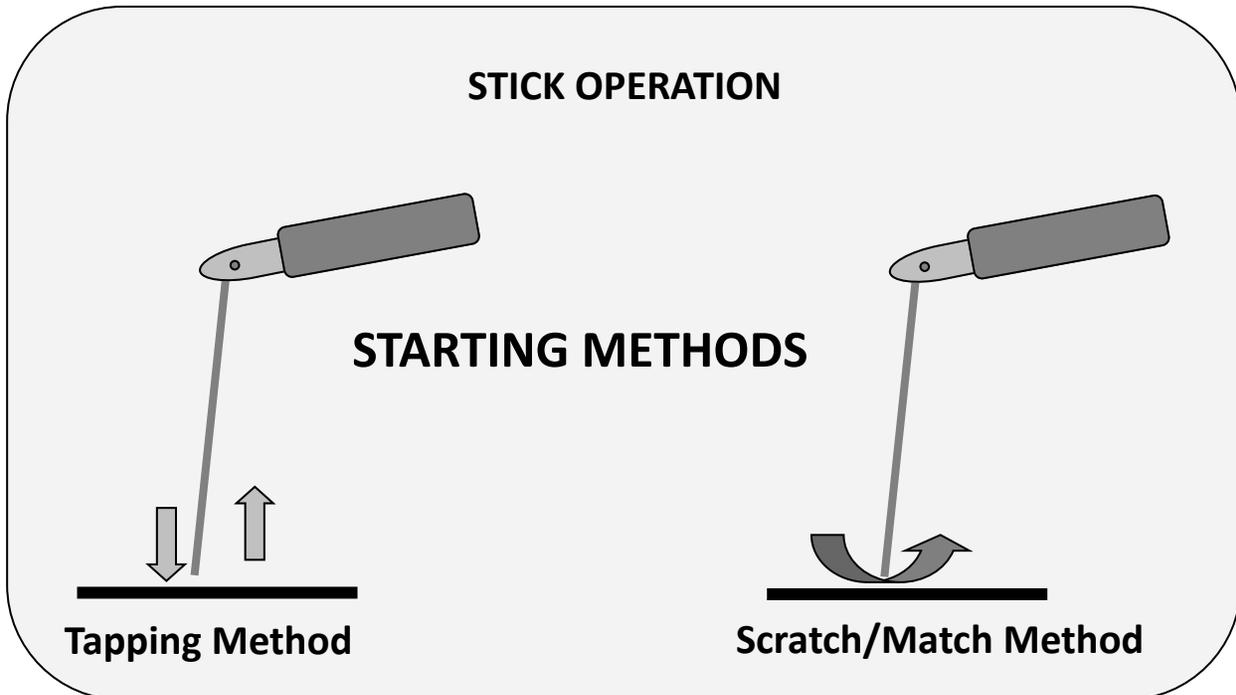

1. Turn on the power switch on the rear of the unit. Allow unit to cycle through its start up program.
2. Select the Stick mode or Stick VRD with the HF/Lift Start/Stick/VRD selector button
3. Make sure electrode holder is hooked into the positive connector and the work clamp is hooked the negative connector.
4. Select the amps desired. Use the electrode diameter selection chart in this manual to determine the approximate range of amps suitable for the rod size selected. Consult the welding electrode manufacturer's recommendation for proper amperage range. Each manufacturer has specific recommendations for its electrodes.
5. Use the arc force control to select the desired arc characteristics, creating the desired arc characteristic and automatic amp response needed to maintain the arc when voltage falls below the threshold. 6011 Cellulose electrodes will require more arc force control than other rods, but each brand and size will weld a little differently. The arc force control setting will vary from person to person as well, with different rod angles, positions, and arc lengths all factoring into the arc force control performance.
6. Adjust Hot Start (%) to create a hotter start than the actual weld current to prevent rod sticking and improve starting reliability. Increase duration (Hot Start Time) to prolong surge until starting is improved.
6. Strike the arc with either the tapping method or the match strike method. Beginners usually find that the match strike method yields best results. Professionals tend to gravitate toward the tapping method because of its placement accuracy which helps prevent arc striking outside of the weld zone.

IMPORTANT: Do not weld in the TIG mode with the stick electrode holder still attached. VRD Function will decrease OCV while machine is idle and cause a slight delay in start.

Section 3

Basic Theory and Function

GENERAL POLARITY RECOMMENDATIONS*

*Follow manufacturer of stick electrode for complete polarity recommendations

PROCESS	TORCH POLARITY	WORK POLARITY
TIG (GTAW)	-	+
STICK (SMAW)	+	-

TIG (GTAW) OPERATION GUIDE FOR STEEL (ALUMINUM)*

*As a general rule, set amperage using 1 amp for every .001" of metal thickness for aluminum. Less is required for DC.

METAL THICKNESS	WELDING AMPS (A)	TUNGSTEN DIA.	Ar FLOW RATE
1-3 mm/.040"-1/8"	40-80 (60-125)	1-2 mm/.040"-3/32"	8-15 CFH /4-7 lpm
3-6 mm/ 1/8"-1/4"	80-200 (125-200)	2-3 mm/ 3/32"-1/8"	15-25 CFH/ 7-14 lpm
6-10 mm 1/4"-5/8"	150-200 (200-350)	3-6 mm/ 1/8"-1/4"	20+ CFH/10-15 lpm.

STICK (SMAW) OPERATION GUIDE

METAL THICKNESS	ELECTRODE SIZE	WELDING AMPS
< 1 mm/.040"	1.5 mm/ 1/16"	20-40
2 mm/.080"	2 mm/3/32"	40-50
3 mm/ 1/8"	3.2 mm/1/8"	90-110
4-5 mm/ 3/16"	3.2-4 mm/ 1/8"	90-130
6-10 mm/ 1/4"-5/8"	4-5 mm/ 1/8"-3/16"	130-250


TUNGSTEN SELECTION GUIDE FOR AN INVERTER

TYPE	PERCENT	COLOR	PROCESS	RECOMMENDATION
Pure	100% Tungsten	Green	AC	NOT RECOMMENDED! Do not use in an inverter.
Thoriated (slightly radioactive)	2% Thorium	Red	AC/DC	YES. Great for all purpose welding. Most economical.
Ceriated	2% Ceria	Orange	AC/DC	YES. Good for low amp use.
Lanthanated	1.5% Lanthanum	Gold	AC/DC	YES. Best alternative to 2% Thoriated. Tough performer.
Lanthanated	2% Lanthanum	Blue	AC/DC	YES. Slight advantage over 1.5% Lanthanated.
Zirconiated	1% Zirconia	Brown	AC	NOT RECOMMENDED! Do not use in an inverter.

NOTE: Thoriated tungsten is slightly radioactive, but is commonly used in the US. Care should be used when grinding so not to breath the dust. If you have concern using thoriated (red) tungsten, choose from Lanthanated or Ceriated tungsten.


EXPANDED VIEW OF TIG TORCH

(Actual appearance may vary slightly from what is listed.)

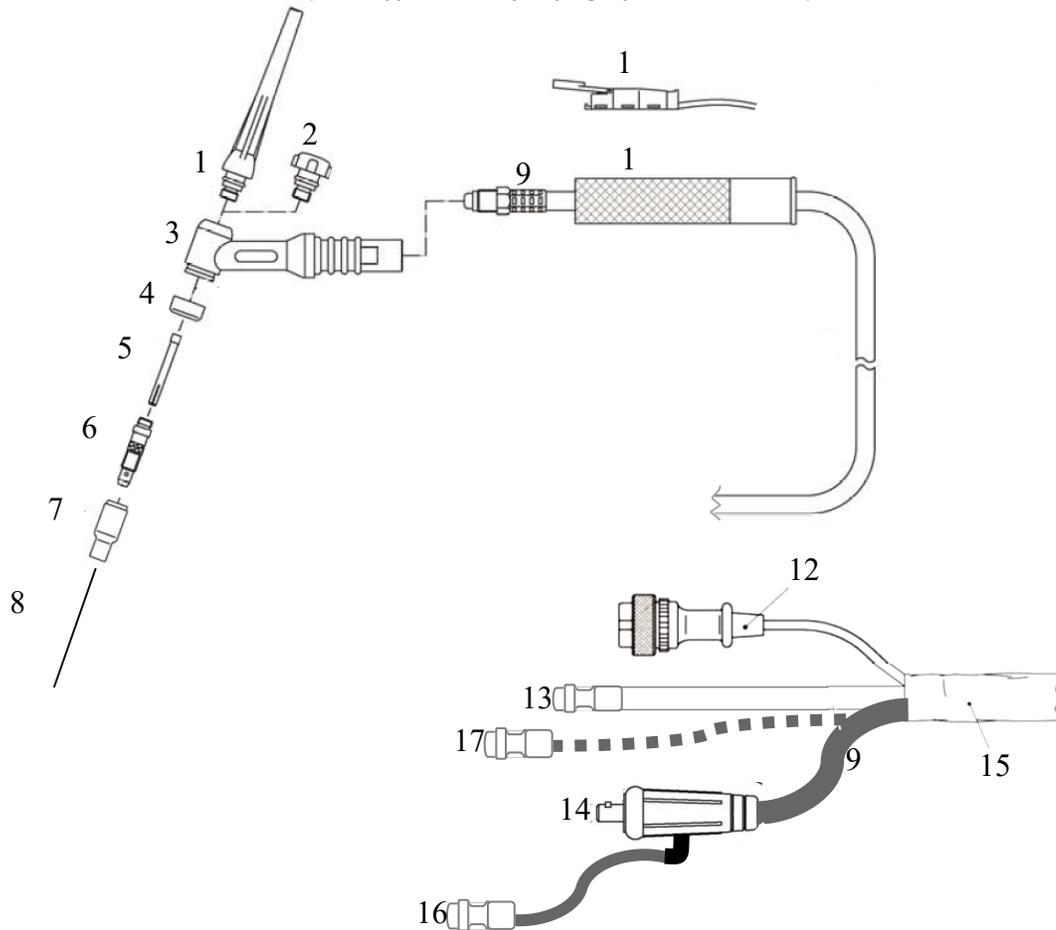

NO.	TYPICAL PARTS FOR Standard Series Torch (STYLE MAY VARY)	QTY.
1	Long Back Cap with O-Ring	1
2	Short Back Cap	Opt.
3	Torch Head	1
4	Insulator	1
5	Collet 1/16 or 3/32	1
6	Collet Holder	1
7	Ceramic Cup #4, 5,6, or 7	1
8	Tungsten (customer supplied)	0
9	Torch Cable	1
10	Torch Handle (Blue ergo handle std, not pictured)	1
11	Torch Switch (Built into ergo handle, separate on straight handle)	1
12	Torch Switch Connector	1
13	9mm (1/8") b quick connect coupling (male) (Water IN, 20 series)	1
14	Power Connector	1
15	Protective Cove (Denim, synthetic rubber or nylon)	1
16	Gas IN (9 series) / Water OUT (20 Series)	
17	Gas IN (20 series only)	

7 PIN CONNECTOR FOR 22K Ω FOOT PEDAL

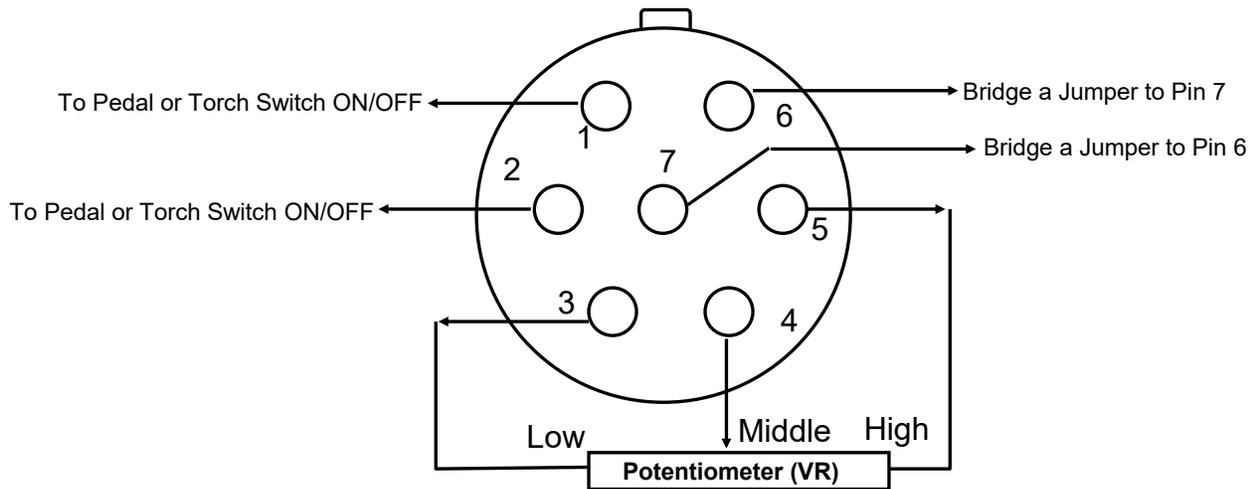

Foot Pedal (22k Ω)

Note: This unit is equipped with a 22K (25K) pedal. However, the unit is designed to accept several different Ohm values, including the older 47K (50K) Ohm pedal without significantly affecting operation. The pinout of the pedal is unchanged in either case.

TROUBLE:	CAUSE/SOLUTION
Machine will not turn on.	Check cords and receptacle wiring. Check circuit breaker.
Machine runs, but will not weld in either mode.	Check for sound work clamp and cable connections. Make sure work cable and TIG Torch are securely fastened to the Dinse style connector. Reset main power switch if overcurrent light is on. Contact Technical Support.
Arc will not start unless lift started or No "spark".	Too long of stand off. Failed HF module. Contaminated tungsten. No tungsten or stick out too short.
Tungsten is rapidly consumed.	Inadequate gas flow. Too small of tungsten. Wrong shielding gas or contaminated shielding gas. Use only Ar. Using green tungsten. Use red thoriated or other color. Wrong polarity . Too much AC cleaning.
Tungsten is contaminated, arc changes to a green color.	Tungsten is dipping into weld. Check and adjust stick out to minimum 1/8 inch. Tungsten is melting. Reduce amperage or increase tungsten size.
Porosity of the Weld. Discolored weld color. Tungsten is discolored.	Low flow rate of shielding gas. High flow rate of shielding gas. Too short of post flow period. Wrong TIG cup size. Possible gas leaks internally or externally due to loose fittings. Base metal is contaminated with dirt or grease.
Weld quality is poor and is dirty/oxidized with possible porosity.	Eliminate drafts. Check if there is sufficient shielding gas left in tank. Check gas flow. Adjust for higher flow of gas. Listen for audible click of gas solenoid. If no click is heard, then contact Everlast Support. Clean weld properly, especially in Aluminum. Too short of post flow time. Check tungsten stick out. Consider using gas lens.
Over current/Duty cycle LED illuminates. Machine runs, but no output.	Duty cycle exceeded or Over current. Allow machine to cool. Reset main power switch after full cool down period. Make sure fan is not blocked. Check wiring. Loose cord.
Unstable Arc.	Poorly ground or shaped tungsten. Regrind to proper point. Too much stand off height. Drafty conditions. Welder fan is blowing on weld area. Move welder to a cart. Wrong polarity. Aluminum: Too much AC positive polarity. Reduce balance to 30% or less. Increase AC Frequency. Possible magnetized base. Reroute cables and/or coil around table leg. Work clamp too far from work piece. Move work clamp close to weld area and clamp direct.
HF spark but no welding arc (often referred to as seeing lightning bolt or small blue spark)	No ground connection. Wrong polarity. Too great of distance between tungsten and work piece. Too large of tungsten with too little amps. Contact Everlast after checking all above issues for possible internal issue.
Unstable arc or irregular starts at low amps. Arc flashing on and off, oscilating between HF and arc.	Start amps/End amps too low for tungsten diameter. Use smaller tungsten. Too far from work piece or inconsistent/shaky standoff height. Reduce tungsten to work distance to 1/32"to 1/16" for low amp start. Move work clamp.
Other issues.	Contact Everlast support.

TROUBLE CODE WITH WARNING LIGHT/UNIT STOPS WELDING BUT IS TURNED ON.	DIAGNOSIS
801	OVER OR UNDER VOLTAGE. Check power input cable for length/size, check input voltage. Running on poor quality power supply or dirty power from generator.
802	OVER TEMPERATURE/ DUTY CYCLE EXCEEDED. Allow unit to rest for 15 minutes. Check for obstacles, clean welder, and heat sinks. Make sure unit is unplugged for 30 minutes before opening up for cleaning.
804	OVER CURRENT. Check to make sure input power cable is correct length and size. Internal unit fault or low input voltage. Possible issue running on generator with dirty power.
805	TORCH SWITCH IS STUCK CLOSED. Turn off welder immediately and check torch switch for stuck contact. Check foot pedal for complete return or stuck micro-switch. Do not hold down the switch or pedal without attempting to strike an arc. Doing so for more than 2 seconds without starting will cause this error code.
OTHER	CONTACT EVERLAST

Notes: